


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Toyota | Model: | Hilux | Body Style: | Utility |
| Year: | 2011 | Registration: | FWN205 | Reg Expiry: | 27 Jan 2019 |
| WoF Expiry: | 27 Apr 2019 | Odometer: | 273,544 Kms | Good No: | 18579418 |
| VIN: | MR0EZ12G704011034 | Next Service: | 276,793kms | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

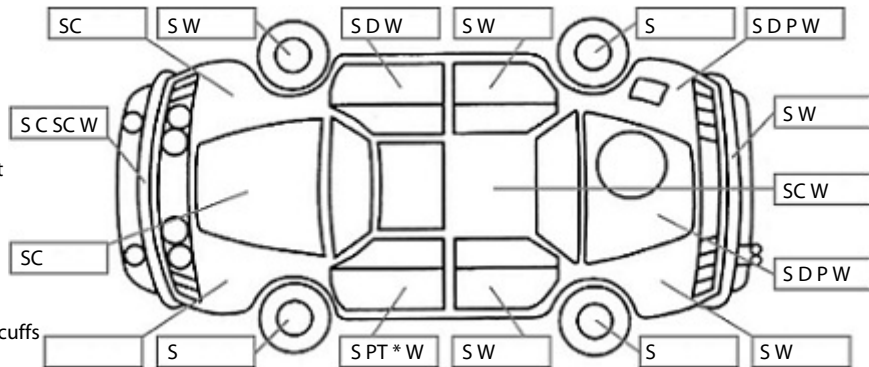

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

2 x screw holes on inside lip of left front guard, from where a aerial has been attached.

Crack in front bumper, by left bottom corner of grille.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Good |
| Panels | Average |
| Dashboard | Average |

General Comments

Large hole in back rest of drivers seat & foam has worn away from around seat frame.

Clutch is starting to slip under load.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes

Kms: 150,948

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | ✓ | |
| CV joints | | | ✓ |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 4.8 | mm | |
| Right front | 5.4 | mm | |
| Left rear | 3.6 | mm | |
| Right rear | 2.2 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Jason Young

Date: 01 Oct 2018

I have read and understood this condition guide.

Name:

Signature: