

Basic Vehicle Condition Guide

Report ID: 18,591,548


Version:

Created: 20 Oct 2018

Make: Model: **Body Style:** Sedan Honda Accord Year: Registration: **Reg Expiry:** 2002 AZB673 16 Jul 2018 **WoF Expiry: Odometer: Good No:** 18591548 13 Aug 2019 247,069 Kms VIN: **Next Service: Service History:** MRHCF85502P030050 227,800kms

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

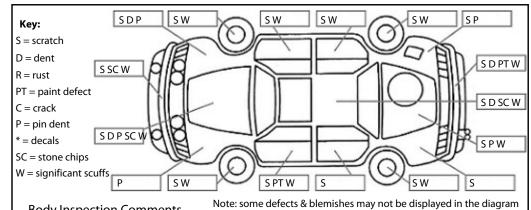

Body Inspection Comments

Key remote not working to lock & unlock vehicle. Stone crack in right side of windscreen, in drivers viewing area of screen, would need repaired to pass a w.o.f. Right front bumper & rear bumper not aligning correctly. Crack in left rear tail light, has been seal up with silicone sealer.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Noise in top end of engine.

Interior Comments			
Seats	Good		
Carpets	Average		
Panels	Good		
Dashboard	Average		

General Comments

Noise in top end of engine. Cig lighter in dash is broken. Screw holes in left side of centre console. Both left side Door lock knobs on interior panels are missing. Speedo display not working correctly. Left side wing mirror not moving around correctly when using switch.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Kms: Yes 200,000

18 Oct 2018 Inspected by: Jason Young

	Pass	Fail	N/A	
Engine				
Oil level		~		
Smoke & fumes		~		
Performance	~			
Noise		~		
Cooling System	•	•		
Coolant condition	~			
Performance	~			
Radiator / Hoses (visual)	~			
Transmission		•		
Operation	~			
Noise	~			
Clutch	\(\times \)			
CV joints	~			
Wheel bearings	~			
Brakes				
Performance	~			
Hand Brake	~			
Tyres (lowest observed tread	depth	of tyre	es)	
Left front	5	.2	mm	
Right front	5.2		mm	
Left rear	1.8		mm	
Right rear	2	.6	mm	
Spare		Yes		
Suspension	•			
Suspension performance	~			
Steering performance	\(\triangle \)			
Shock absorbers	~			
Air Conditioning / Heater		!		
Operation	~			
Electrical / Accessories				
Head lights	~			
Tail lights		~		
Indicators	~			
Dashboard warning lights	~			
Wipers (front & rear)	V V V V V			
Window winder FL	~			
Window winder FR	~			
Window winder RL	~			
Window winder RR	~			
Rear view mirrors	~			
Radio (basic test only)	~			
CD (basic test only)	~			
Number of keys	1	•		
Central locking	~			
Remote locking		~		
Sat. Nav. (basic test only)			~	
Reversing camera			~	
			•	

I have read and understood this condition guide.

Name:

Signature: