


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Toyota | Model: | Corolla | Body Style: | Hatchback |
| Year: | 2001 | Registration: | FTL925 | Reg Expiry: | 06 Nov 2018 |
| WoF Expiry: | 06 Apr 2019 | Odometer: | 215,318 Kms | Good No: | 18598471 |
| VIN: | 7AT0H607X10006245 | Next Service: | | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

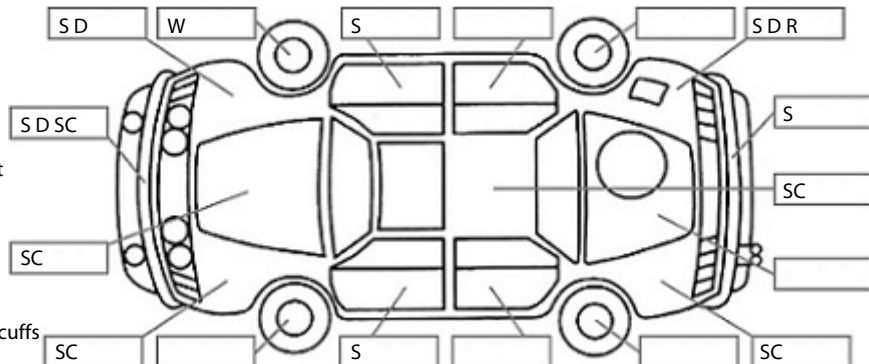

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Hubcaps missing LHS. Damage on RR guard. Stonechips on windscreen. Headlamps need buffing. Aerial damaged. Steering wheel worn. Console lid hinge damaged. AC not cold. Screen on stereo not working. RF seatbelt sometimes difficult to extend.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Engine and automatic transmission have oil seepage. Rear suspension bushes perished, both sides.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Handbrake needs adjustment.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|--|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 5 | mm | |
| Right front | 5 | mm | |
| Left rear | 4 | mm | |
| Right rear | 5 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | | ✓ | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | | | ✓ |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Roger King

Date: 11 Oct 2018

I have read and understood this condition guide.

Name:

Signature: