


Make:	Mazda	Model:	Bounty	Body Style:	Utility
Year:	2006	Registration:	DHB551	Reg Expiry:	20 Oct 2019
WoF Expiry:	08 Jun 2019	Odometer:	289,391 Kms	Good No:	18600390
VIN:	MM0UNY0W2004196	Next Service:	300000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

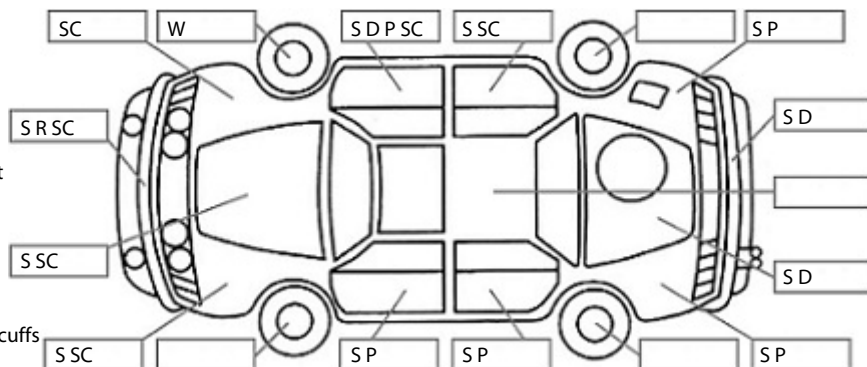

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Stonechips on windscreen, may need replacing. RH taillight lens has damage. RF indicator lens has hole and dirt inside. Bonnet trim is missing. Both front mudflaps damaged. Screw holes in dash. Scratches on glovebox. LF central and remote locking not working. LR door ashtray missing. Wheel brace missing.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufacturers recommended level suggest coolant change. RR shock has oil seepage. RR axle seal starting to weep.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

1x Tonneau cover rope post missing RHS of tray. Rust and damage to front bumper RHS. Chrome coming off RH mirror.
Wear on RF and rear seats. Holes in dash RHS.
Engine may need glowplugs checking.
Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 211,000

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	10	mm	
Right front	10	mm	
Left rear	3	mm	
Right rear	3	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers		✓	
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking		✓	
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 15 Oct 2018

I have read and understood this condition guide.

Name:

Signature: