


<b>Make:</b>	Subaru	<b>Model:</b>	Legacy	<b>Body Style:</b>	Wagon
<b>Year:</b>	2003	<b>Registration:</b>	DQB502	<b>Reg Expiry:</b>	11 May 2019
<b>WoF Expiry:</b>	07 Dec 2018	<b>Odometer:</b>	211,831 Kms	<b>Good No:</b>	18618844
<b>VIN:</b>	JF1BP9KK44G003344	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

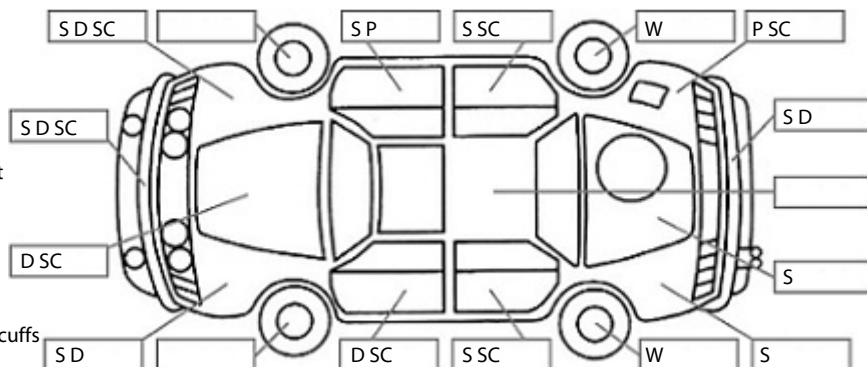

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Scuffs on LH sill. LR door body rubber not fitting correctly. Paint coming off all wheels. Damage on RF guard. Clock has error. Mobile mount on console. Wires hanging below glovebox. Carper on cargo area damaged. RF seat has wear. Lens missing in RF door card.

Conditions During Body Inspection: Wet

## Under Carriage & Under Bonnet Inspection Comments

All front and rear swaybar links are worn. Rear swaybar bushes are worn. Aftermarket mufflers fitted to rear of exhaust.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Trim around RH muffler tip in rear bumper missing. Damage on rear bumper.

Drives ok.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 180,275

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	6	mm	
Right front	6	mm	
Left rear	3	mm	
Right rear	3	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 30 Oct 2018

I have read and understood this condition guide.

Name: .....

Signature: .....