


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Mitsubishi | Model: | Pajero | Body Style: | SUV |
| Year: | 2004 | Registration: | CCE864 | Reg Expiry: | 12 Mar 2019 |
| WoF Expiry: | 08 Feb 2019 | Odometer: | 229,071 Kms | Good No: | 18619768 |
| VIN: | JMFLYV77W4J003399 | Next Service: | | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

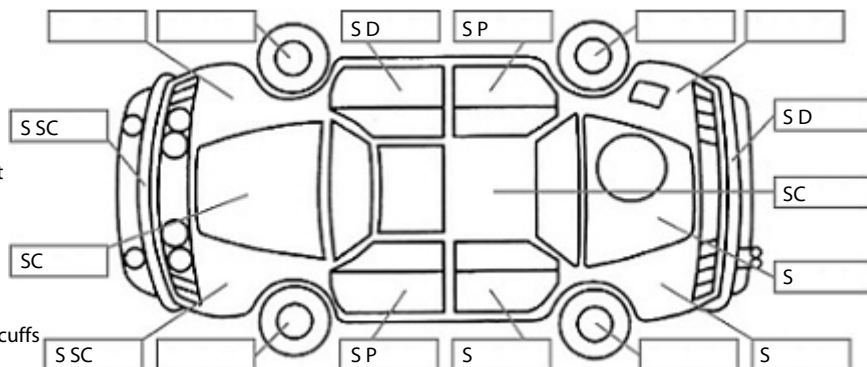

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Rust in seam in roof beside sunroof, open sunroof. Stonechips on windscreen. LH taillight lens cracked. LH taillight not going. All outer door handles have paint coming off. Corrosion on both front wheels. Headlamps need buffing.
Wear on all seats. 4wd lights in dash have blown bulb.

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufacturers recommended level, contains only water no additive, suggest coolant change and flush. Rust marks by both bonnet hinges. Exhaust leak at front.

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Drives ok.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 201,000

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | | ✓ | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | | | ✓ |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 5 | mm | |
| Right front | 5 | mm | |
| Left rear | 2 | mm | |
| Right rear | 2 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | | ✓ | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 3 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Roger King

Date: 30 Oct 2018

I have read and understood this condition guide.

Name:

Signature: