


Make:	Holden	Model:	Commodore	Body Style:	Wagon
Year:	2005	Registration:	JTH319	Reg Expiry:	10 Oct 2018
WoF Expiry:	09 Nov 2019	Odometer:	281,692 Kms	Good No:	18632771
VIN:	6G1ZK82B15L490786	Next Service:		Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

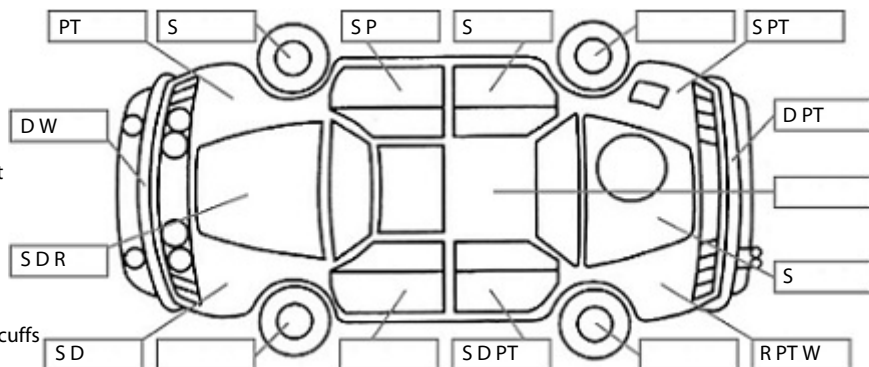

Note: some defects & blemishes may not be displayed in the diagram

Body Inspection Comments

Fuel lid missing
Front bumper and fender colour difference. Front bumper, bonnet misaligned, Rear bumper misaligned, RH tail lamp broken
Normal wheel fitted on FL, water in spare wheel area, rusty. Tail gate handle insecure, tail door inner trim insecure.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Bonnet gas strut 1 broken, 1 weak, Battery insecure
Radiator leak, coolant rusty, Surface rust on radiator support
Power steering hose leak, rack boot split open
Engine oil low, leak
Underbody surface rust

Interior Comments

Seats	Poor
Carpets	Poor
Panels	Poor
Dashboard	Average

General Comments

Key remote missing parts, separate keys for door and ignition
FR, RR park lights not working
Driver's door inner handle, RR door lock knob missing, FR seat trim insecure
Airbag warning shows on dashboard, Rattling from front wheel during test drive. Engine misfire in idle

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Performance		✓	
Noise	✓		
Cooling System			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)		✓	
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings		✓	
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	1.6	mm	
Right front	3	mm	
Left rear	2	mm	
Right rear	0	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Mathew Varghese

Date: 13 Nov 2018

I have read and understood this condition guide.

Name:

Signature: