

Basic Vehicle Condition Guide

Report ID: 18,851,490


Version: 1

Created: 13 Dec 2018

Make: Model: Hyundai Getz **Body Style:** Hatchback Year: 2005 Registration: CQY29 Reg Expiry: 29 Jul 2019 WoF Expiry: **Odometer:** 03 Aug 2019 111,635 Kms **Good No:** 18851490 VIN: KMHBT51HR5U36289 Next Service: 119049 **Service History:**

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

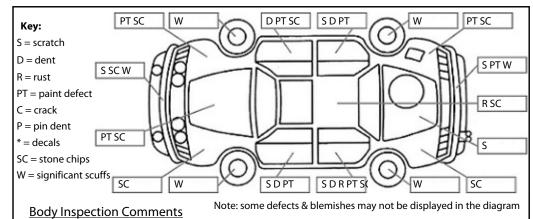

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

AC not getting cold Underbody and under bonnet oxidisation Left front window switch faulty Oil leak

Interior Comments	
Seats	Average
Carpets	Carpets worn, hole in drivers carpet
Panels	Scratch on right rear panel
Dashboard	Average

General Comments

Exhaust leak

Inspected by:

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

John Lindsay

Evidence of Cam Belt Replacement: Yes Kms:

Kms: 97,000

	Pass	Fail	N/A
Engine			
Oil level	~		
Smoke & fumes	~		
Performance	~		
Noise		~	
Cooling System			
Coolant condition	~		
Performance	~		
Radiator / Hoses (visual)	~		
Transmission			
Operation	~		
Noise	~		
Clutch			~
CV joints	~		
Wheel bearings	~		
Brakes			
Performance	~		
Hand Brake	~		
Tyres (lowest observed tread	depth	of tyre	es)
Left front		2	mm
Right front	5		mm
Left rear	7		mm
Right rear	7		mm
Spare		Yes	
Suspension			
Suspension performance	~		
Steering performance	<i>V</i>		
Shock absorbers	~		
Air Conditioning / Heater	ı		ı
Operation		~	
Electrical / Accessories			
Head lights	~		
Tail lights	~		
Indicators	\(\triangle \)		
Dashboard warning lights	~		
Wipers (front & rear)	~		
Window winder FL		~	
Window winder FR	~		
Window winder RL	~		
Window winder RR	~		
Rear view mirrors	\(\times \)		
Radio (basic test only)	~		
CD (basic test only)	~		
Number of keys	2	<u> </u>	1
Central locking	~		
Remote locking	~		
Sat. Nav. (basic test only)			~
Reversing camera			~
<u> </u>	l		

I have read and understood this condition guide.

Name			

13 Dec 2018

Date: