


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Mazda | Model: | B2500 | Body Style: | Utility |
| Year: | 1998 | Registration: | CCM474 | Reg Expiry: | 01 Feb 2019 |
| WoF Expiry: | 01 Feb 2019 | Odometer: | 351,082 Kms | Good No: | 18875984 |
| VIN: | JM0UFY0W500133726 | Next Service: | | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

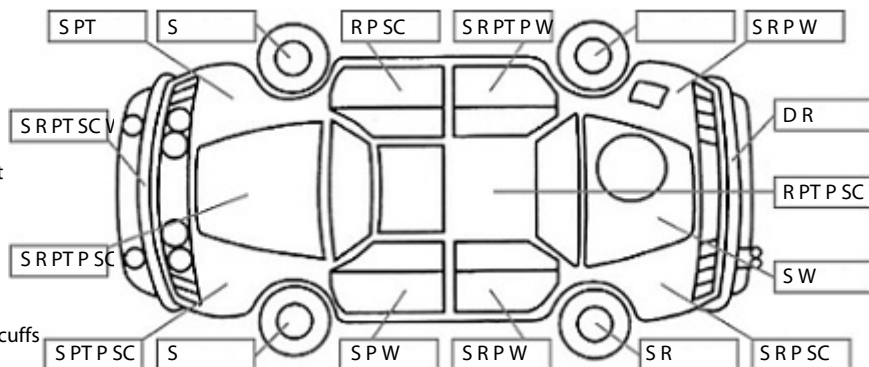

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Paint fade left front quarter, bonnet, right front quarter, front bumper and roof, crack in left tail light, scratch marks on right tail light, damage around right canopy window, rust on both wiper blade arms,

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Interior Comments

| | |
|-----------|--------------------------------|
| Seats | Average |
| Carpets | minor stains |
| Panels | left front door handle broken. |
| Dashboard | horn centre cap missing. |

General Comments

A slight whine in the steering, no coolant in the radiator, horn not working.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 322,651

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | | ✓ | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | ✓ | | |
| Cooling System | | | |
| Coolant condition | | ✓ | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | ✓ | | |
| CV joints | ✓ | | |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 4 | mm | |
| Right front | 6 | mm | |
| Left rear | 3 | mm | |
| Right rear | 3 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | | ✓ | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 2 | | |
| Central locking | ✓ | | |
| Remote locking | | | ✓ |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Donovan Matara

Date: 24 Jan 2019

I have read and understood this condition guide.

Name:

Signature: