

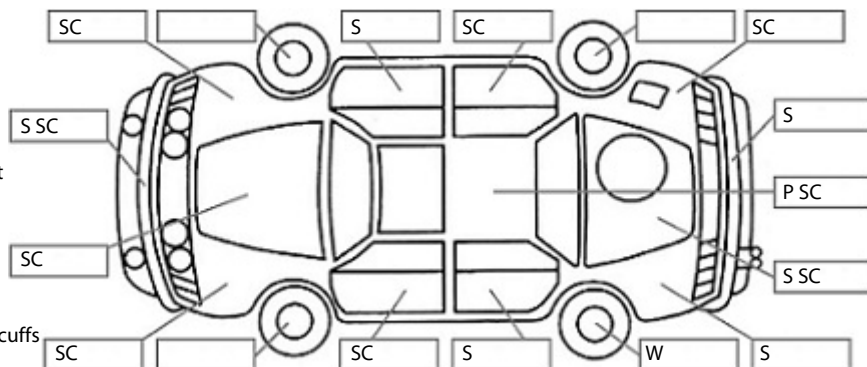
<b>Make:</b>	Holden	<b>Model:</b>	Commodore	<b>Body Style:</b>	Sedan
<b>Year:</b>	2002	<b>Registration:</b>	FSB386	<b>Reg Expiry:</b>	28 Jan 2020
<b>WoF Expiry:</b>	24 Nov 2019	<b>Odometer:</b>	230,429 Kms	<b>Good No:</b>	18899028
<b>VIN:</b>	6H8VXK69A2L861227	<b>Next Service:</b>	235000	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs


**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

LH number plate lamp not going. RH mirror hand painted. Stonechips on windscreen. Badges damaged on boot lid.  
AC not cold. Lid on console pocket not shutting. All speaker covers on doors are damaged. Wear on RF seat. Remote locking not working, key fobs damaged.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Engine has oil seepage. Tailshaft seal on automatic transmission has oil seepage. LF swaybar link is worn. Rear suspension crossmember and tow bar are rusty. LR shock has oil seepage. Towbar has no tongue.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

Engine running rough at idle. Rattle in RF wheel area over bumps, needs further investigation.  
Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain  
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	2	mm	
Right front	3	mm	
Left rear	5	mm	
Right rear	5	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers		✓	
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 05 Mar 2019

I have read and understood this condition guide.

Name: .....

Signature: .....