


| | | | | | |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| Make: | Toyota | Model: | Hiace | Body Style: | Van |
| Year: | 2007 | Registration: | DRM629 | Reg Expiry: | 09 Jan 2020 |
| WoF Expiry: | 13 Aug 2019 | Odometer: | 359,970 Kms | Good No: | 19115366 |
| VIN: | JTFHT02P305000041 | Next Service: | 360,000 | Service History: | No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

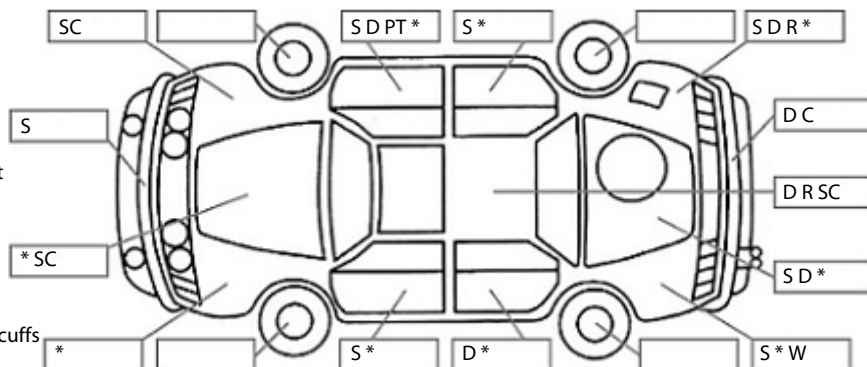

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

RH headlamp, FR door broken. RH mirror faded. RR door moulding insecure. Tail door moulding torn. Rear seat back shaking. Spare wheel inside. LH taillamp cracked. Rear badge missing
FR foot step trim insecure. Stone chip on front windscreen
Front tyres inner edge wear. LH mirror broken

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Battery insecure
Gearbox oil leak
Radiator bottom support rusty

Interior Comments

| | |
|-----------|------|
| Seats | Poor |
| Carpets | Poor |
| Panels | Poor |
| Dashboard | Poor |

General Comments

FR, RR park lights not working. aC vents broken
Engine not starting at times, starter motor/ flywheel needs attention
Engine shaking while starting, mountings weak

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

| | Pass | Fail | N/A |
|--|------|------|-----|
| Engine | | | |
| Oil level | ✓ | | |
| Smoke & fumes | ✓ | | |
| Performance | ✓ | | |
| Noise | | ✓ | |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | ✓ | | |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | ✓ | | |
| Noise | ✓ | | |
| Clutch | ✓ | | |
| CV joints | | | ✓ |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | ✓ | | |
| Hand Brake | ✓ | | |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 0 | mm | |
| Right front | 0 | mm | |
| Left rear | 4 | mm | |
| Right rear | 5 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | ✓ | | |
| Steering performance | ✓ | | |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | | ✓ | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | | | ✓ |
| Window winder RR | | | ✓ |
| Rear view mirrors | | ✓ | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | | | ✓ |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | | | ✓ |

Inspected by: Mathew Varghese

Date: 09 Mar 2019

I have read and understood this condition guide.

Name:

Signature: