


<b>Make:</b>	Holden	<b>Model:</b>	Rodeo 4X2	<b>Body Style:</b>	Utility
<b>Year:</b>	2005	<b>Registration:</b>	CYD637	<b>Reg Expiry:</b>	19 Feb 2020
<b>WoF Expiry:</b>	22 May 2019	<b>Odometer:</b>	282,580 Kms	<b>Good No:</b>	19149919
<b>VIN:</b>	MPATFR77H5H58463	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

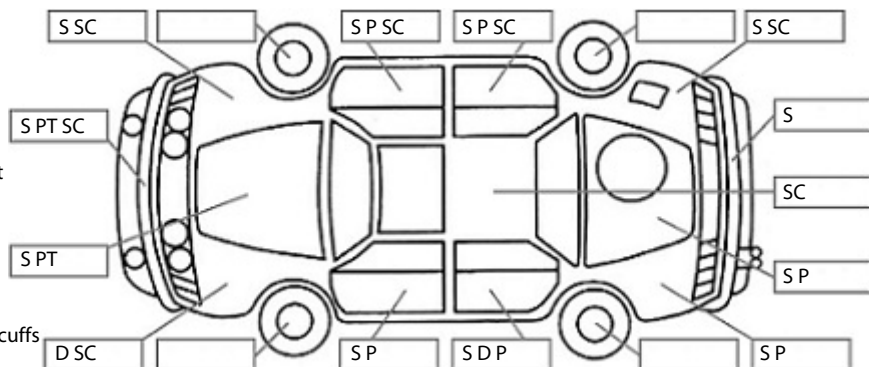

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

RH number plate lamp not going. Both spotlamps not going. Sports bar in tray is not secure. Stonechips on windscreen. Bonnet has been sanded back to primer. Front bumper has been repainted badly. Extra switches in dash. Switch blank missing. Lower section of RH dash not fitting correctly.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Engine is gear drive. Engine has oil seepage. Oil on accessory catch tank fitted to LH inner guard. LF swaybar link is worn. Chassis has surface rust. Both front tyres have inner edge wear.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Clutch needs adjustment and has slight shudder. Nudge bar not secure. All door cards have wear. RF seat and seatbelt have wear. AC not cold.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Unknown

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	2	mm	
Right front	2	mm	
Left rear	1.2	mm	
Right rear	0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 13 May 2019

I have read and understood this condition guide.

Name: .....

Signature: .....