


<b>Make:</b>	Daihatsu	<b>Model:</b>	Storia	<b>Body Style:</b>	Hatchback
<b>Year:</b>	2000	<b>Registration:</b>	EBS830	<b>Reg Expiry:</b>	23 May 2019
<b>WoF Expiry:</b>	14 Aug 2019	<b>Odometer:</b>	188,632 Kms	<b>Good No:</b>	19164893
<b>VIN:</b>	7A847230707000405	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

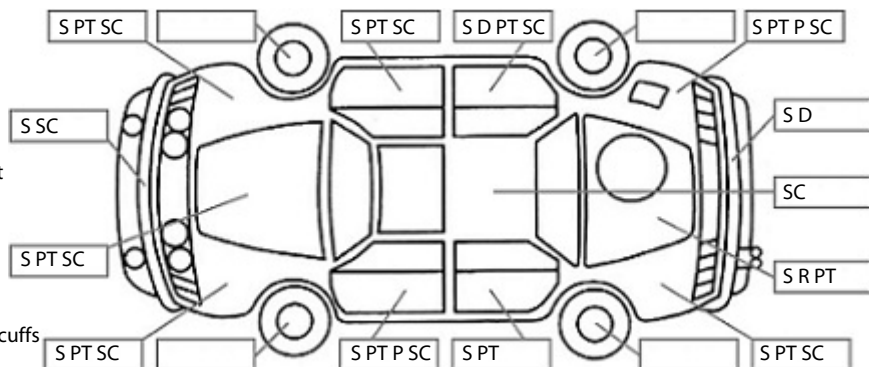

Note: some defects & blemishes may not be displayed in the diagram

## Body Inspection Comments

RF window switch damage, cannot check RF window operation. Suntan lotion damage on paint. LF door monsoon broken. Tailgate has primer paint. No jack handle. Boot board damaged. Rust marks inside tailgate. RR door lock knob missing. Stonechips on windscreen. All wheels rusty.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Engine has oil seepage. Upper radiator support panel is rusty. Engine drive belt noisy. Coolant additive concentration below manufactures recommended level suggest coolant change. Surface rust under floor. Front brake pads low. Gearbox has oil seepage.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Gearbox sometimes difficult to engage 1st gear.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5	mm	
Right front	4	mm	
Left rear	4	mm	
Right rear	4	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR		✓	
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 17 Apr 2019

I have read and understood this condition guide.

Name: .....

Signature: .....