

Basic Vehicle Condition Guide

Report ID: 19,165,759


Version: 1

Created: 24 Apr 2019

Make: Model: Toyota Landcruiser Prado **Body Style:** SUV Year: 2001 Registration: **AAI984** Reg Expiry: 04 Oct 2019 **Odometer:** WoF Expiry: 20 Nov 2019 207,603 Kms **Good No:** 19165759 VIN: JTEBN95JX00082542 Next Service: 214115 Service History:

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

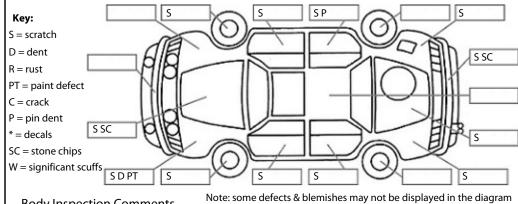

Body Inspection Comments

Interior front roof light not working

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Underbody surface rust

FL cv boot grease leak, FR lower arm bush crack Engine oil leak, Transmission transfer case oil leak

Steering rack oil leak

Suspension bush cracked

Interior Co	omments

Seats	Good
Carpets	Good
Panels	Average
Dashboard	Average

General Comments

Steering knocking noise Front shock absorber weak

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

I have read and understood this condition guide.

Evidence of Cam Belt Replacement: Kms:

		-		_
Inspected by:	Sudhin Ramachandran	Date:	24 Apr 201	9
				_

Name:

_							
1		Pass	Fail	N/A			
ı	Engine						
ı	Oil level	~					
	Smoke & fumes	v v					
1	Performance	~					
ı	Noise	~					
ı	Cooling System	•	•	•			
	Coolant condition	~					
1	Performance	~					
ı	Radiator / Hoses (visual)	~					
,	Transmission						
J	Operation	~					
	Noise	~					
J	Clutch			~			
ı	CV joints		~				
]	Wheel bearings	~					
	Brakes						
ı	Performance	~					
ı	Hand Brake	~					
ı	Tyres (lowest observed tread	depth	of tyre	 es)			
ı	Left front			mm			
ı	Right front		.5	mm			
	Left rear		.5 .5	mm			
٦	Right rear		.5 .5	mm			
_	Spare		Yes				
	Suspension		103				
ı	Suspension performance		1				
ı	Steering performance		<i>v</i>				
ı	Shock absorbers		~				
ı	Air Conditioning / Heater		•				
_	Operation	·/					
	Electrical / Accessories						
ı	Head lights	v					
ı	Tail lights						
ı	Indicators	· ·					
ı	Dashboard warning lights	•					
ı	Wipers (front & rear)	\(\times \) \(\t					
ı	Window winder FL	•					
	Window winder FR	•					
1	Window winder RL	\(\times \)					
ı	Window winder RR	./					
ı	Rear view mirrors	~					
ı							
	Radio (basic test only)	V					
	CD (basic test only)	_					
_	Number of keys	1					
	Central locking	<i>V</i>					
7	Remote locking						
	Sat. Nav. (basic test only)			<i>'</i>			
_	Reversing camera		<u> </u>				
	Date: 24 Apr 2019						
_							

Signature: