

Basic Vehicle Condition Guide

Report ID: 19,473,744


Version:

Created: 01 May 2019

Make: **BMW** Model: 3181 **Body Style:** Sedan Year: 2001 Registration: FKG890 Reg Expiry: 06 Mar 2019 WoF Expiry: **Odometer:** 19 Jul 2019 101,092 Kms **Good No:** 19473744 VIN: WBAAN92010NJ0291 Next Service: Service History:

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

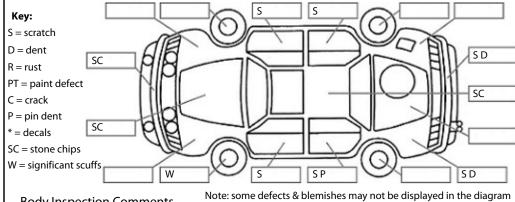

Body Inspection Comments

Rear bumper misaligned

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Engine oil leak Battery insecure Rear wheel drive

| Interior | Comments |
|-----------|-----------|
| IIIICIIOI | Commencia |

| Seats | Average |
|-----------|---------|
| Carpets | Average |
| Panels | Average |
| Dashboard | Average |

General Comments

Inspected by:

Roof lining falls Engine oil check light on RL window fail One remote button missing One remote control not working

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A | | |
|------------------------------|--------------|---------|---------------------------------------|--|--|
| Engine | | | | | |
| Oil level | ~ | | | | |
| Smoke & fumes | \(\times \) | | | | |
| Performance | ~ | | | | |
| Noise | ~ | | | | |
| Cooling System | | | | | |
| Coolant condition | ~ | | | | |
| Performance | ~ | | | | |
| Radiator / Hoses (visual) | ~ | | | | |
| Transmission | | | | | |
| Operation | ~ | | | | |
| Noise | ~ | | | | |
| Clutch | | | ~ | | |
| CV joints | | | ~ | | |
| Wheel bearings | ~ | | | | |
| Brakes | | | | | |
| Performance | ~ | | | | |
| Hand Brake | ~ | | | | |
| Tyres (lowest observed tread | depth | of tyre | es) | | |
| Left front | 2 | 2.5 | mm | | |
| Right front | 2.5 | | mm | | |
| Left rear | 1.5 | | mm | | |
| Right rear | | 2 | mm | | |
| Spare | | Yes | | | |
| Suspension | | | | | |
| Suspension performance | ~ | | | | |
| Steering performance | ~ | | | | |
| Shock absorbers | ~ | | | | |
| Air Conditioning / Heater | | | | | |
| Operation | ~ | | | | |
| Electrical / Accessories | | | | | |
| Head lights | ~ | | | | |
| Tail lights | ~ | | | | |
| Indicators | ~ | | | | |
| Dashboard warning lights | | ~ | | | |
| Wipers (front & rear) | ~ | | | | |
| Window winder FL | ~ | | | | |
| Window winder FR | ~ | | | | |
| Window winder RL | | ~ | | | |
| Window winder RR | ~ | | | | |
| Rear view mirrors | ~ | | | | |
| Radio (basic test only) | ~ | | | | |
| CD (basic test only) | v | | | | |
| Number of keys | 1 | | | | |
| Central locking | · · | | | | |
| Remote locking | _ | ~ | - | | |
| Sat. Nav. (basic test only) | | | / | | |
| Reversing camera | | | \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ | | |
| | | | | | |

I have read and understood this condition guide.

Xinghui Lin

Name:

Signature:

01 May 2019

Date: