


<b>Make:</b>	Holden	<b>Model:</b>	UTE	<b>Body Style:</b>	Utility
<b>Year:</b>	2008	<b>Registration:</b>	KTZ856	<b>Reg Expiry:</b>	14 May 2019
<b>WoF Expiry:</b>	12 Dec 2019	<b>Odometer:</b>	147,011 Kms	<b>Good No:</b>	19483829
<b>VIN:</b>	6G1EK42728L130661	<b>Next Service:</b>	145,000kms	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

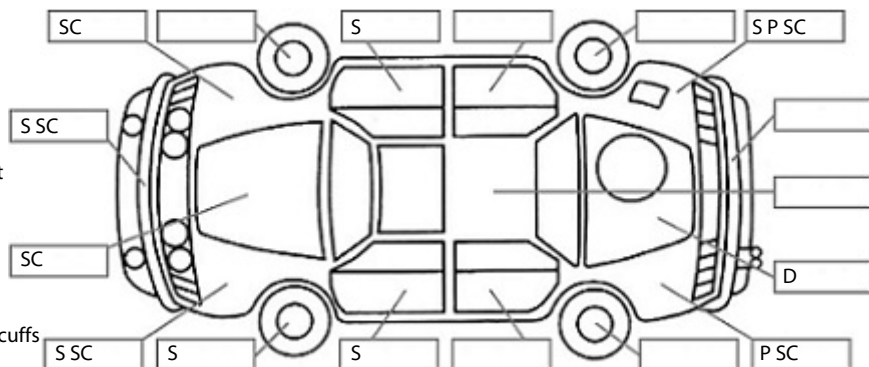

**Body Inspection Comments**

- Stone chips in windscreen.
- Scratches on left side sill.

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

ADVISED: DO NOT DRIVE - Radiator has gearbox oil in it.

**Interior Comments**

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

**General Comments**

- No road test, as has oil in coolant system.
- Radiator has gearbox oil in it.
- Power steering is very heavy.
- Radiator cap will not come off.
- Both Key remote pads are worn but still work.
- Plastic trim panel on side of drivers seat is crack & a clip is broken on it.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition		✓	
Performance		✓	
Radiator / Hoses (visual)		✓	
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	6.0	mm	
Right front	6.0	mm	
Left rear	1.2	mm	
Right rear	1.2	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance		✓	
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 13 May 2019

I have read and understood this condition guide.

Name: .....

Signature: .....