

# **Basic Vehicle Condition Guide**

Report ID: 19,486,089


Version: 1

Created: 22 May 2019

Make: Model: Toyota Avalon **Body Style:** Sedan Year: 2003 Registration: **BRB780 Reg Expiry:** 01 Jul 2019 WoF Expiry: **Odometer:** 19 Nov 2019 236,425 Kms **Good No:** 19486089 VIN: 6T153XH1006029822 **Next Service:** 242,000kms **Service History:** 

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

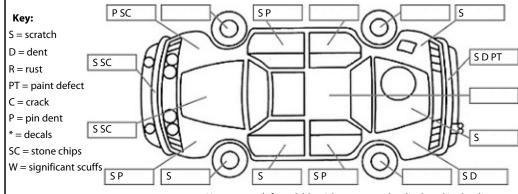

#### **Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Stone chips in windscreen. Right side of rear bumper is not fitting correctly to right rear guard.

Conditions During Body Inspection: Dry

### **Under Carriage & Under Bonnet Inspection Comments**

Oil leaks around right side of engine & around engine sump pan. Oil leak from gearbox.

<u>Interior Comments</u>				
Seats	Good			
Carpets	Good			
Panels	Good			
Dashboard	Good			

## **General Comments**

Drivers seat belt webbing is worn. Drivers door strap is broken. Small hole in base of drivers seat & leather is worn on seat. Radio will not load cd's into unit. Both key remotes are not working & rubber pads on remotes have worn off.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 144,172

Inspected by: Jason Young Date: 14 May 2019

Name: .....

		T	T		
	Pass	Fail	N/A		
Engine					
Oil level	\( \times \)				
Smoke & fumes	~				
Performance	~				
Noise	~				
Cooling System					
Coolant condition	~				
Performance	\( \times \)				
Radiator / Hoses (visual)	~				
Transmission					
Operation	~				
Noise	~				
Clutch			~		
CV joints	~				
Wheel bearings	~				
Brakes					
Performance	~				
Hand Brake	~				
Tyres (lowest observed tread depth of tyres)					
Left front 5.4 mm					
Right front	5	.7	mm		
Left rear	5	.2	mm		
Right rear	6	.0	mm		
Spare		Yes			
Suspension					
Suspension performance	~				
Steering performance	~				
Shock absorbers	~				
Air Conditioning / Heater					
Operation	~				
Electrical / Accessories					
Head lights	~				
Tail lights	~				
Indicators					
Dashboard warning lights	~				
Wipers (front & rear)	\( \times \)				
Window winder FL	~				
Window winder FR	~				
Window winder RL	~				
Window winder RR	~				
Rear view mirrors	·				
Radio (basic test only)	·				
CD (basic test only)	-	~			
Number of keys	2				
Central locking	·				
Remote locking		~			
Sat. Nav. (basic test only)		+	<b>V</b>		
Reversing camera			~		
		L			

Signature: .....