


<b>Make:</b>	Hyundai	<b>Model:</b>	H1	<b>Body Style:</b>	Van
<b>Year:</b>	2010	<b>Registration:</b>	FPY280	<b>Reg Expiry:</b>	17 Jun 2019
<b>WoF Expiry:</b>	08 Nov 2019	<b>Odometer:</b>	166,935 Kms	<b>Good No:</b>	19488897
<b>VIN:</b>	KMHWH81JMBU2862	<b>Next Service:</b>		<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

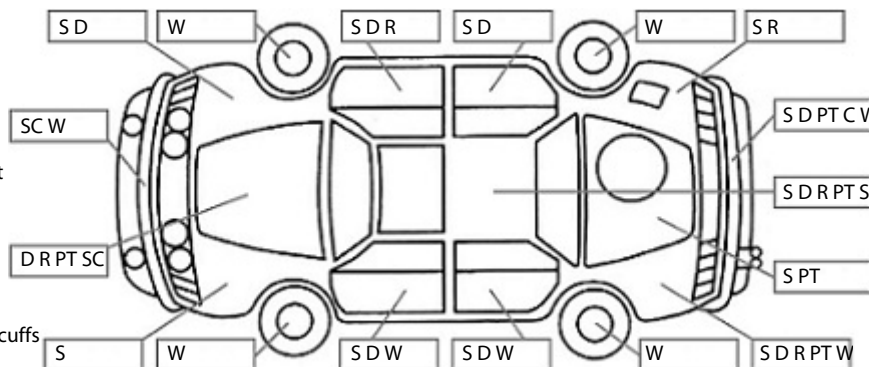

Note: some defects & blemishes may not be displayed in the diagram

**Body Inspection Comments**

Driver door seal damaged  
Rear bumper alignment, right side held on with cable tie  
Chip windscreen

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Abs warning light and ESP warning light stay on  
Right sliding door damaged(hard to open)  
Oil level low  
Drive shaft universal joint seals leaking  
Drive shaft to rear differential seal leaking

**Interior Comments**

Seats	middle left seat rip, driver seat worn
Carpets	left front mat worn
Panels	front door handles worn
Dashboard	Average

**General Comments**

Drivers door creaks

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level		✓	
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	5	mm	
Right front	6	mm	
Left rear	8	mm	
Right rear	3	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL		✓	
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: John Lindsay

Date: 14 May 2019

I have read and understood this condition guide.

Name: .....

Signature: .....