


<b>Make:</b>	Hyundai	<b>Model:</b>	Accent	<b>Body Style:</b>	Hatchback
<b>Year:</b>	2000	<b>Registration:</b>	ZN5594	<b>Reg Expiry:</b>	04 May 2019
<b>WoF Expiry:</b>	07 Jan 2020	<b>Odometer:</b>	183,384 Kms	<b>Good No:</b>	19491799
<b>VIN:</b>	KMHCG51GRYU05941	<b>Next Service:</b>		<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

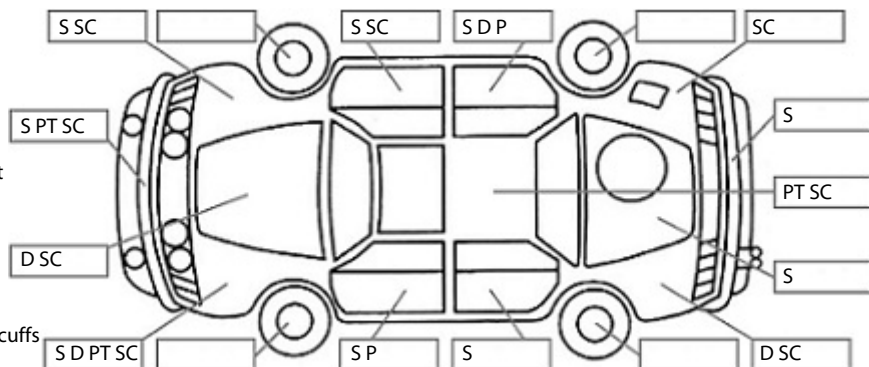

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Clearcoat is coming off vehicle. LF hubcap broken. LF&RF window channels damaged. Rust on LR&RR window channels. RR taillight held with tape. Wear on steering wheel. RF inner door handle broken. RF seat is worn. Heater vent control not working. AC not cold. LF inner mirror trim held with tape.

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

RH bonnet hinge partially seized and has bent hinge. Engine has oil seepage. Front suspension crossmember has surface rust.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

Engine drive belt noisy. Stonechips on windscreen. Wiper rack has wear. Wear on RF seat.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	4	mm	
Right front	2	mm	
Left rear	4	mm	
Right rear	2	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 20 May 2019

I have read and understood this condition guide.

Name: .....

Signature: .....