

Basic Vehicle Condition Guide

Report ID: 19,503,715


Version: 1

Created: 29 May 2019

Make: Model: Toyota Hiace **Body Style:** Van Year: 2007 Registration: KFJ777 Reg Expiry: 31 May 2019 **Odometer:** WoF Expiry: **Good No:** 23 Mar 2020 192,044 Kms 19503715 VIN: 7AT0H60FX16062232 Next Service: 152,115 Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

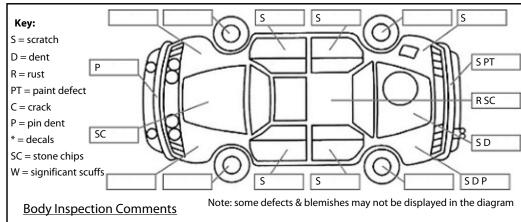

Stone chip on front windscreen

LH front mirror missing

Driver's seat torn

FL power window not working

No seat belts for rear row seat. Front both seat belts not retracting properly

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Engine oil overfilled

2WD

Interior Comments		
Seats	Average	
Carpets	Average	
Panels	Average	
Dashboard	Average	

General Comments

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

Inspected by: Mathew Varghese

Create	d: 29	9 May 2	2019
	Pass	Fail	N/A
Engine			•
Oil level		~	
Smoke & fumes	~		
Performance	~		
Noise	~		
Cooling System			•
Coolant condition	~		
Performance	~		
Radiator / Hoses (visual)	~		
Transmission	•		•
Operation	~		
Noise	~		
Clutch			~
CV joints			~
Wheel bearings	~		
Brakes	•		•
Performance	~		
Hand Brake	~		
Tyres (lowest observed tread	depth	of tyre	es)
Left front		5	mm
Right front		7	mm
Left rear		5	mm
Right rear		5	mm
Spare		Yes	
Suspension			
Suspension performance	~		
Steering performance	ν ν		
Shock absorbers	~		
Air Conditioning / Heater			
Operation	~		
Electrical / Accessories			
Head lights	~		
Tail lights	~		
Indicators	\(\times \)		
Dashboard warning lights	~		
Wipers (front & rear)	~		
Window winder FL		~	
Window winder FR	~		
Window winder RL			~
Window winder RR			~
Rear view mirrors	~		
Radio (basic test only)	~		
CD (basic test only)	~		
Number of keys	1	1	
Central locking	~		
Remote locking			~
Sat. Nav. (basic test only)			~
	ı	1	1 4

Reversing camera

29 May 2019

1

have read and understood this condition guide.	Name:	Signature: