

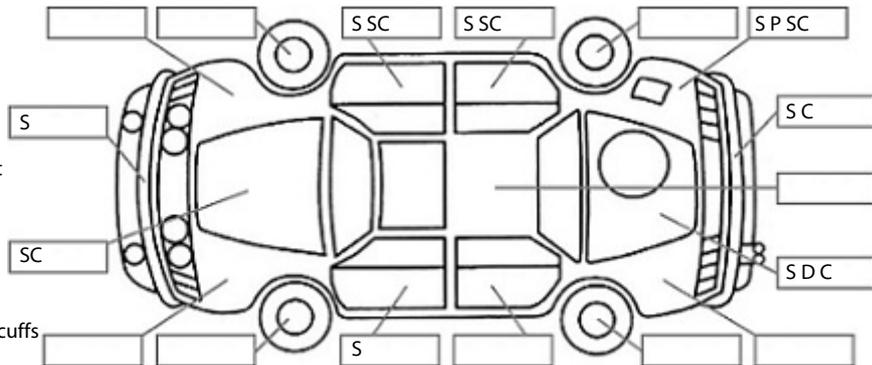
<b>Make:</b> Mazda	<b>Model:</b> Bongo	<b>Body Style:</b> Van
<b>Year:</b> 2008	<b>Registration:</b> HSK446	<b>Reg Expiry:</b> 16 Oct 2019
<b>WoF Expiry:</b> 18 Oct 2019	<b>Odometer:</b> 174,864 Kms	<b>Good No:</b> 19513186
<b>VIN:</b> 7AT0C10WX14401863	<b>Next Service:</b> 180000	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs


**Body Inspection Comments**

Note: some defects &amp; blemishes may not be displayed in the diagram

Damage on tailgate. Aerial is broken.  
No rear seat seatbelts. Wear on RF seat, small cut on LHS on back of LH seat. RH tread plate broken.

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

Rear tyres LH outer 3mm inner 4 mm. RH tyres both 4mm. Some surface rust at front of vehicle and on RF jack mount on chassis.  
Small spare tyre is low on pressure and is perished.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt  
Evidence of Cam Belt Replacement: Yes                      Kms: 101,547

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	5	mm	
Right front	5	mm	
Left rear	3	mm	
Right rear	4	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 06 Jun 2019

I have read and understood this condition guide.      Name: .....      Signature: .....