


<b>Make:</b>	Toyota	<b>Model:</b>	Liteace	<b>Body Style:</b>	Van
<b>Year:</b>	1997	<b>Registration:</b>	BZH665	<b>Reg Expiry:</b>	07 Apr 2020
<b>WoF Expiry:</b>	15 Oct 2019	<b>Odometer:</b>	304,739 Kms	<b>Good No:</b>	19513592
<b>VIN:</b>	7A8H60J0704007246	<b>Next Service:</b>	313,647kms	<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

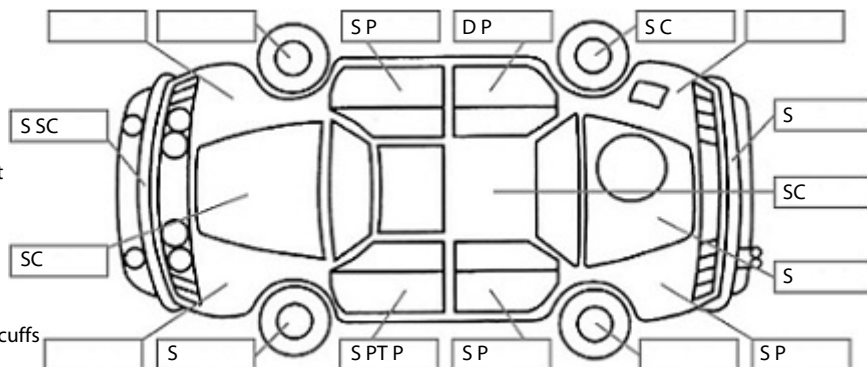

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Interior door lights on both front doors are not working & lenses have broken off. Missing right front wheel hub cap. Stone chips in windscreen.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Engine glow plug light flashing on & off on dash display when on road test. Oil leak from right side of engine & from around engine rocker cover on top of engine.

## Interior Comments

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

## General Comments

Radiator/coolant system needs a flush & suspected block radiator. Front exhaust flange is leaking. Left side sliding door is not unlocking or locking with central locking. Key remote is not working. Centre console is not screwed in place correctly. Handbrake needs adjustment.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake		✓	
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	6.5	mm	
Right front	6.2	mm	
Left rear	2.8	mm	
Right rear	3.8	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking		✓	
Remote locking		✓	
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 10 Jun 2019

I have read and understood this condition guide.

Name: .....

Signature: .....