


Make:	Isuzu	Model:	Bighorn	Body Style:	Wagon
Year:	1993	Registration:	CWY783	Reg Expiry:	30 Jun 2020
WoF Expiry:	19 Sep 2019	Odometer:	235,760 Kms	Good No:	19516840
VIN:	7A897130705208863	Next Service:	236833	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

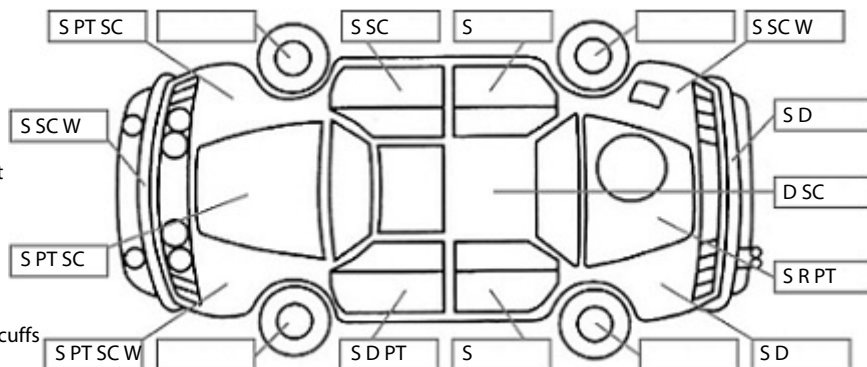

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Spotlights and RH number plate lamp not going. Parking mirror missing on LF guard. Clearcoat is coming off vehicle. Rust on door weatherstrips. Vent missing LR guard. Roof spoiler panel missing. Rust spot on small back door by catch. Stonechips on windscreen. Damage on LR door card. Wear on RF seat

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Engine has oil leaks. Oil on turbo piping. Turbo has whine. Rust on chassis, and rust on chassis by front cab mounts. Rear diff pinion seal has oil seepage. Both rear axle seals have oil seepage.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Sun roof not operating.

Drives ok.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 211,104

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	6	mm	
Right front	7	mm	
Left rear	7	mm	
Right rear	7	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	3		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 12 Jun 2019

I have read and understood this condition guide.

Name:

Signature: