


Make:	Toyota	Model:	Landcruiser	Body Style:	Van
Year:	1995	Registration:	TW3926	Reg Expiry:	10 Jan 2020
WoF Expiry:	25 Jul 2019	Odometer:	342,271 Kms	Good No:	19517396
VIN:	JT711UJ8008022175	Next Service:		Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

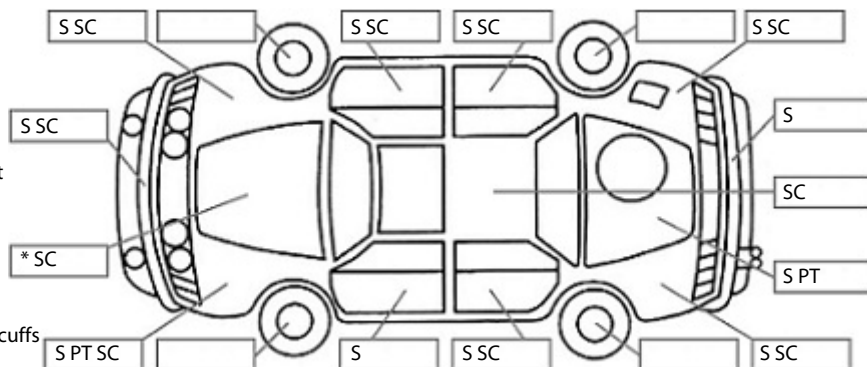

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Filler strip and paint damaged on LF flare. LR flare not secure. LH taillight has crack in lens. Paint defect on tailgate.
All electric windows need attention but RF in not working when going up.
Both front seats are worn. 2nd row seat damaged on RH upper corner. 3rd row seats not bolted in.

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Engine and power steering reservoir have oil leaks. Chassis, running board mounts, towbar and exhaust have surface rust. Slight weeping from both front axle seals. Surface rust in some areas on Inner sills.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Stonechips on windscreen. Rust under treadplate RF door. Rear wiper not going.
No seatbelts on 3rd row seats. Tailgate gas struts not working. Wear on RF seatbelt. Radio has no sound.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	4	mm	
Right front	3	mm	
Left rear	11	mm	
Right rear	11	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)		✓	
Window winder FL	✓		
Window winder FR		✓	
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 12 Jun 2019

I have read and understood this condition guide.

Name:

Signature: