


| | | |
|--------------------------------|-----------------------------|--------------------------------|
| Make: Nissan | Model: Note | Body Style: Hatchback |
| Year: 2005 | Registration: HYD155 | Reg Expiry: 16 Jul 2019 |
| WoF Expiry: 05 Mar 2020 | Odometer: 86,745 Kms | Good No: 19524073 |
| VIN: 7AT0DH79X14079369 | Next Service: - | Service History: No |

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
 D = dent
 R = rust
 PT = paint defect
 C = crack
 P = pin dent
 * = decals
 SC = stone chips
 W = significant scuffs

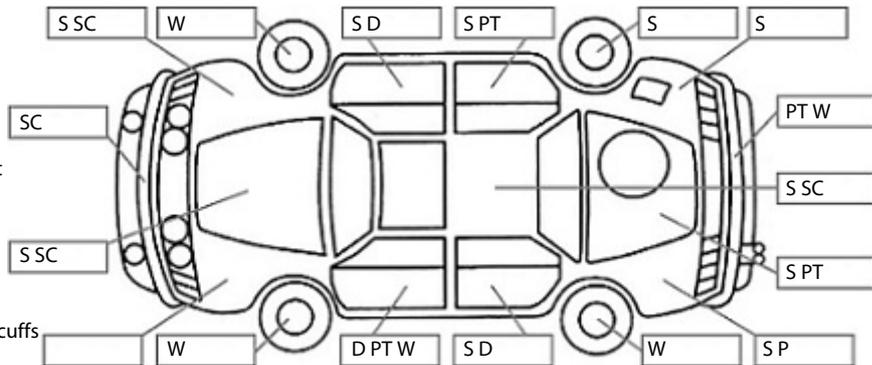

Note: some defects & blemishes may not be displayed in the diagram

Body Inspection Comments

Headlights dull
 Front end misaligned
 Tailgate outside handle loose
 Front windscreen rubber seal loose

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Front wheel drive/Engine oil sludgy - no test drive until flushing/No engine oil/Drive belt cracks and noisy/underbody surface rust

Interior Comments

| | |
|-----------|---------|
| Seats | Average |
| Carpets | Average |
| Panels | Poor |
| Dashboard | Average |

General Comments

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

| | Pass | Fail | N/A |
|---|------|------|-----|
| Engine | | | |
| Oil level | | ✓ | |
| Smoke & fumes | | | ✓ |
| Performance | | | ✓ |
| Noise | | | ✓ |
| Cooling System | | | |
| Coolant condition | ✓ | | |
| Performance | | | ✓ |
| Radiator / Hoses (visual) | ✓ | | |
| Transmission | | | |
| Operation | | | ✓ |
| Noise | | | ✓ |
| Clutch | | | ✓ |
| CV joints | | | ✓ |
| Wheel bearings | ✓ | | |
| Brakes | | | |
| Performance | | | ✓ |
| Hand Brake | | | ✓ |
| Tyres (lowest observed tread depth of tyres) | | | |
| Left front | 3 | mm | |
| Right front | 3 | mm | |
| Left rear | 4 | mm | |
| Right rear | 4 | mm | |
| Spare | Yes | | |
| Suspension | | | |
| Suspension performance | | | ✓ |
| Steering performance | | | ✓ |
| Shock absorbers | ✓ | | |
| Air Conditioning / Heater | | | |
| Operation | ✓ | | |
| Electrical / Accessories | | | |
| Head lights | ✓ | | |
| Tail lights | ✓ | | |
| Indicators | ✓ | | |
| Dashboard warning lights | ✓ | | |
| Wipers (front & rear) | ✓ | | |
| Window winder FL | ✓ | | |
| Window winder FR | ✓ | | |
| Window winder RL | ✓ | | |
| Window winder RR | ✓ | | |
| Rear view mirrors | ✓ | | |
| Radio (basic test only) | ✓ | | |
| CD (basic test only) | ✓ | | |
| Number of keys | 1 | | |
| Central locking | ✓ | | |
| Remote locking | ✓ | | |
| Sat. Nav. (basic test only) | | | ✓ |
| Reversing camera | ✓ | | |

Inspected by: Ca Thach

Date: 18 Jun 2019

I have read and understood this condition guide. Name: Signature: