


Make:	Subaru	Model:	Impreza	Body Style:	Wagon
Year:	1993	Registration:	ZB1940	Reg Expiry:	03 Mar 2020
WoF Expiry:	24 Oct 2019	Odometer:	210,725 Kms	Good No:	19524189
VIN:	7A8GF090700007180	Next Service:	206,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

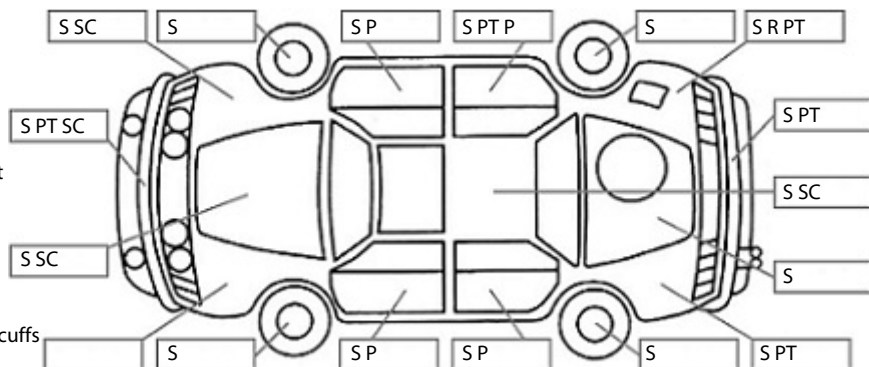

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Front of right side monsoon shield is broken off. Stone chips in windscreen. Paint work clear coat is lifting off front bumper, left rear guard, rear bumper, right rear guard & right rear door.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Oil leak between engine & gearbox & both right & left side rocker covers. Power steering fluid leaking from right side of steering rack. Left side head gasket is weeping.

Interior Comments

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

General Comments

Left front headlight not working on low beam. Drivers seat belt webbing is starting to wear. Gearshift linkage is worn, still selects all gears fine. Rear brake lights are not working. Horn is not working. Radiator/coolant system needs a flush.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes

Kms: 107,841

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance		✓	
Noise	✓		
Cooling System			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	4.8	mm	
Right front	5.3	mm	
Left rear	5.8	mm	
Right rear	5.8	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights		✓	
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 18 Jul 2019

I have read and understood this condition guide.

Name:

Signature: