


Make:	Toyota	Model:	Landcruiser	Body Style:	SUV
Year:	1998	Registration:	LQW975	Reg Expiry:	31 Aug 2019
WoF Expiry:	11 Oct 2019	Odometer:	296,773 Kms	Good No:	19544480
VIN:	JT731PJ7508551391	Next Service:	299,800kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

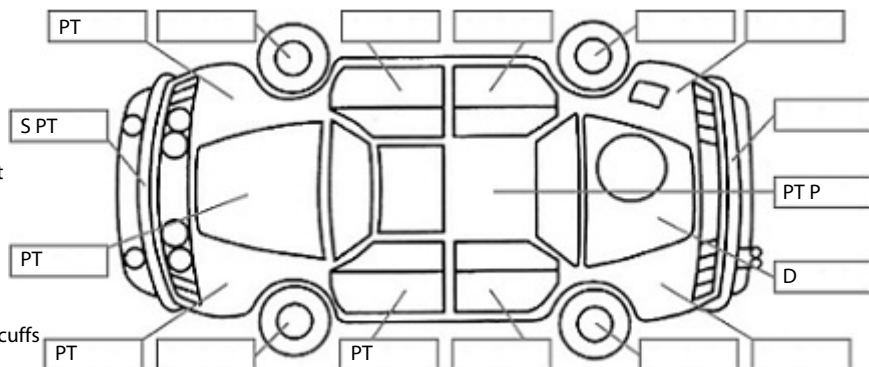

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Has paint imperfections on all body panels, has been repainted. Small stone crack in right side of windscreen.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Power steering hoses are leaking. Cross member under gearbox is bent. 4wd transfer box is leaking oil. Right & left front leaf spring bushes worn & need replaced. Suspension sagging on right front of vehicle.

Interior Comments

Seats	Good
Carpets	Good
Panels	Good
Dashboard	Good

General Comments

Interior head lining is sagging. Door lock knob on inside of drivers door is missing. Steering column has movement in bracket. Cig lighter is missing from socket. ###Correct kms are 296,735kms### cd player is not working. Suspension sagging on right front.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes

Kms: 296,515

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	7.8	mm	
Right front	5.2	mm	
Left rear	5.1	mm	
Right rear	2.4	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation			✓
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking			✓
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 04 Jul 2019

I have read and understood this condition guide.

Name:

Signature: