


<b>Make:</b>	Ford	<b>Model:</b>	Territory	<b>Body Style:</b>	Wagon
<b>Year:</b>	2005	<b>Registration:</b>	HPL662	<b>Reg Expiry:</b>	21 Aug 2019
<b>WoF Expiry:</b>	16 Oct 2019	<b>Odometer:</b>	207,710 Kms	<b>Good No:</b>	19600212
<b>VIN:</b>	6FPAAJGAT4E51994	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

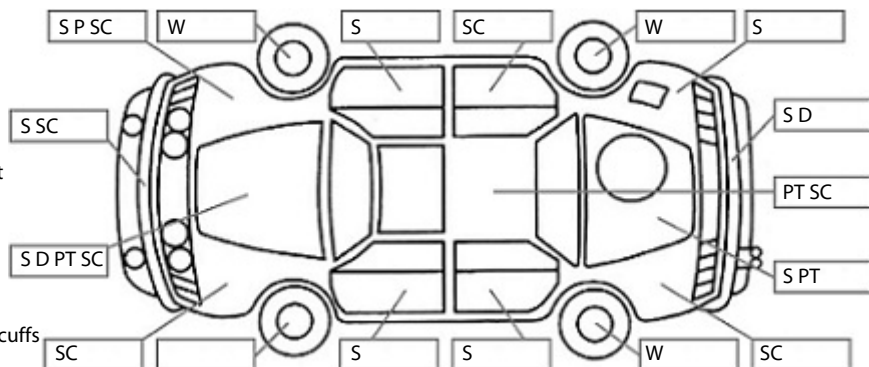

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Wiper mechanism is worn. RH low beam not going. Headlamps need buffing. LF and RR center caps missing. Clearcoat is coming off vehicle. Number plate lamp holder is cracked. Lid on top of dash is damaged. Catch on console lid broken. Gear lever knob worn. LF window not working. AC not cold.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Engine has oil leaks. Rust on both corners of inner guards and firewall. Surface rust under floor and suspension. Driveshaft center bearing worn. Engine drive belt noisy.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

RR inner door pull is damaged. Stonechips on windscreen. Wear on RF seat. Bottom rear corner of trim on LF and RF doors is broken. Outer edge wear on both front tyres. Handbrake needs adjusting.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	2	mm	
Right front	3	mm	
Left rear	6	mm	
Right rear	7	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation		✓	
<b>Electrical / Accessories</b>			
Head lights		✓	
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL		✓	
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 09 Jul 2019

I have read and understood this condition guide.

Name: .....

Signature: .....