

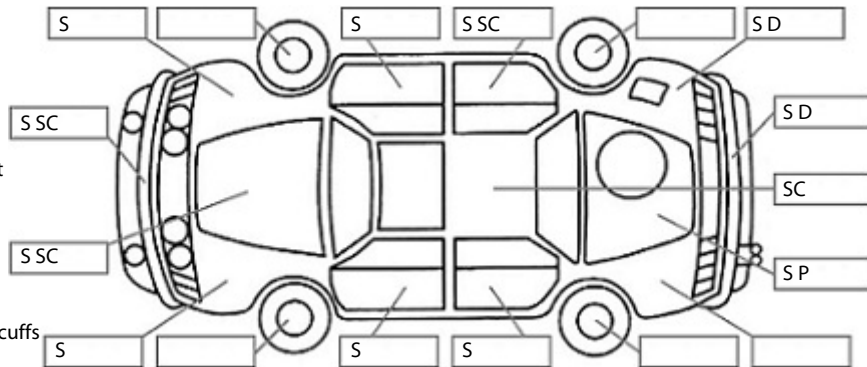
<b>Make:</b> Nissan	<b>Model:</b> Navara	<b>Body Style:</b> Utility
<b>Year:</b> 2007	<b>Registration:</b> DTA43	<b>Reg Expiry:</b> 11 Nov 2019
<b>WoF Expiry:</b> 19 Aug 2020	<b>Odometer:</b> 243,747 Kms	<b>Good No:</b> 19784471
<b>VIN:</b> VSKCVND40A0163461	<b>Next Service:</b> 253000	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs


**Body Inspection Comments**

Note: some defects &amp; blemishes may not be displayed in the diagram

RR taillight broken and taped into vehicle, taillight bulb not going. LH number plate light damaged. Rear bumper step not secure. Tailgate handle trim damaged. Stonechips on windscreen. LR seat headrest missing. Wear on RF seat.

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

Coolant additive concentration below manufactures recommended level suggest coolant change. Incorrect lid on radiator overflow bottle. Engine has oil leak.

**Interior Comments**

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

**General Comments**

Drives ok.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain  
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	8	mm	
Right front	8	mm	
Left rear	8	mm	
Right rear	7	mm	
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 10 Sep 2019

I have read and understood this condition guide. Name: ..... Signature: .....