


<b>Make:</b>	GMC	<b>Model:</b>	Sierra	<b>Body Style:</b>	Utility
<b>Year:</b>	1995	<b>Registration:</b>	KFF443	<b>Reg Expiry:</b>	30 Jan 2020
<b>WoF Expiry:</b>	23 Mar 2020	<b>Odometer:</b>	155,809 Miles	<b>Good No:</b>	19803573
<b>VIN:</b>	2GTFK29S5S1531318	<b>Next Service:</b>		<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

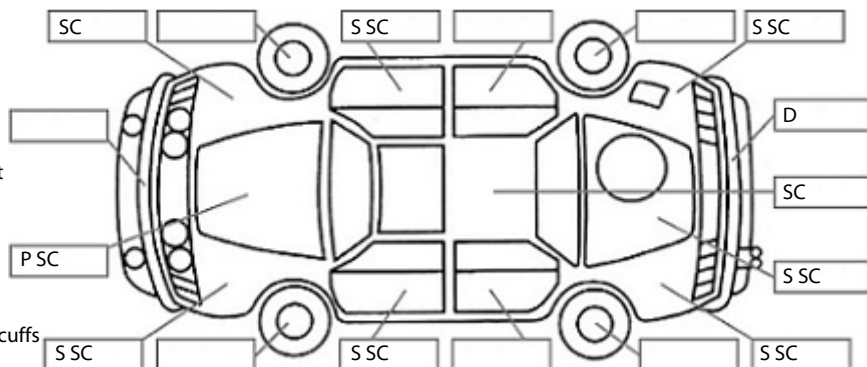

## Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Rubber trim on both sides of vehicle has wear. LH mirror is damaged. LH taillight has crack in lens. Both taillight lenses need buffing. Stonechips on windscreen. LED lights on front bumper not going. Rubber insert on front bumper has wear. Radio has USA type tuner so will not get many NZ stations.

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufactures recommended level suggest coolant change. Has aftermarket pod airfilter fitted. Tailshaft seal on automatic transmission has oil seepage. Chassis has surface rust.

## Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

## General Comments

Headlight switch loose in dash. Park brake release knob missing.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	6	mm	
Right front	7	mm	
Left rear	6	mm	
Right rear	5	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 10 Sep 2019

I have read and understood this condition guide.

Name: .....

Signature: .....