

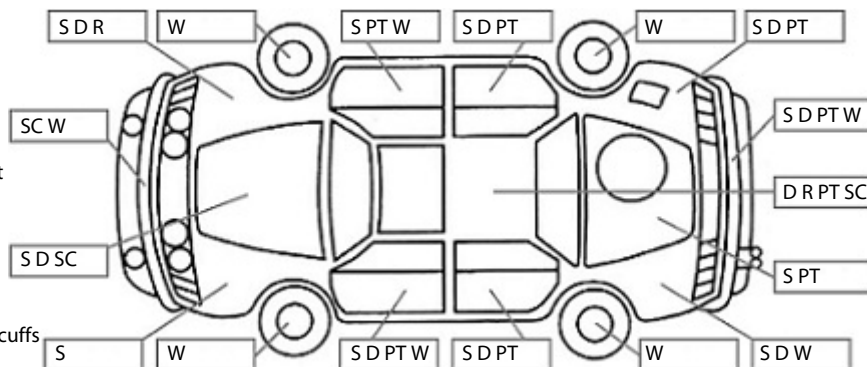
<b>Make:</b>	Holden	<b>Model:</b>	Viva	<b>Body Style:</b>	Wagon
<b>Year:</b>	2007	<b>Registration:</b>	EBK88	<b>Reg Expiry:</b>	01 Oct 2019
<b>WoF Expiry:</b>	22 Mar 2020	<b>Odometer:</b>	190,214 Kms	<b>Good No:</b>	19807731
<b>VIN:</b>	KL3NA35BJ7K662793	<b>Next Service:</b>	197000	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs


**Body Inspection Comments**

Rear bumper right side alignment  
Chip windscreen outside CVA

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Check engine light on  
Centre console lid missing  
Most buttons on radio not working  
Left rear window only works from master switch  
Engine/gearbox oil leak  
Front left tyre outer edge wear

**Interior Comments**

Seats	stains, driver seat loose
Carpets	Average
Panels	Average
Dashboard	driver side compartment loose

**General Comments**

Gearbox slips

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 120,000

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation		✓	
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	2	mm	
Right front	2	mm	
Left rear	4	mm	
Right rear	5	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: John Lindsay

Date: 16 Sep 2019

I have read and understood this condition guide.

Name: .....

Signature: .....