


<b>Make:</b>	Mercedes-Benz	<b>Model:</b>	A190	<b>Body Style:</b>	Hatchback
<b>Year:</b>	1999	<b>Registration:</b>	DSD877	<b>Reg Expiry:</b>	07 Feb 2020
<b>WoF Expiry:</b>	23 Feb 2020	<b>Odometer:</b>	129,608 Kms	<b>Good No:</b>	19809519
<b>VIN:</b>	WDB1680332J232424	<b>Next Service:</b>	?	<b>Service History:</b>	No

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

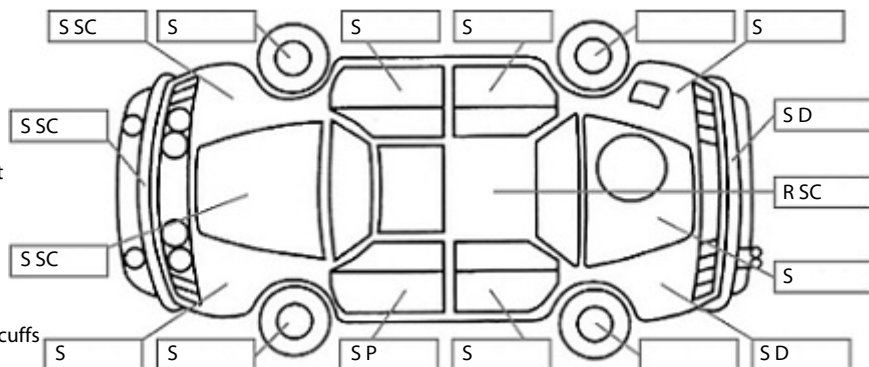

## Body Inspection Comments

Plastic trim around high stop tail light is missing & rear tailgate gas struts need replaced. Stone chips in windscreen. Left rear tail light lens is cracked & broken. Right side wing mirror cover is a different colour to rest of vehicle.

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Left front outer cv boot is split.

## Interior Comments

Seats	Good
Carpets	Good
Panels	Average
Dashboard	Average

## General Comments

Digital kms display is not lighting up. Right side heater vent adjustment knob on dashboard is broken off & missing. Crack in dash by right side heater vent.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	7.0	mm	
Right front	7.0	mm	
Left rear	6.2	mm	
Right rear	6.2	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 23 Sep 2019

I have read and understood this condition guide.

Name: .....

Signature: .....