


Make:	Holden	Model:	Rodeo 4X2	Body Style:	Utility
Year:	2004	Registration:	CGE828	Reg Expiry:	01 Jan 2020
WoF Expiry:	25 Jan 2020	Odometer:	282,182 Kms	Good No:	19863711
VIN:	MPATFR26H4H50654	Next Service:		Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

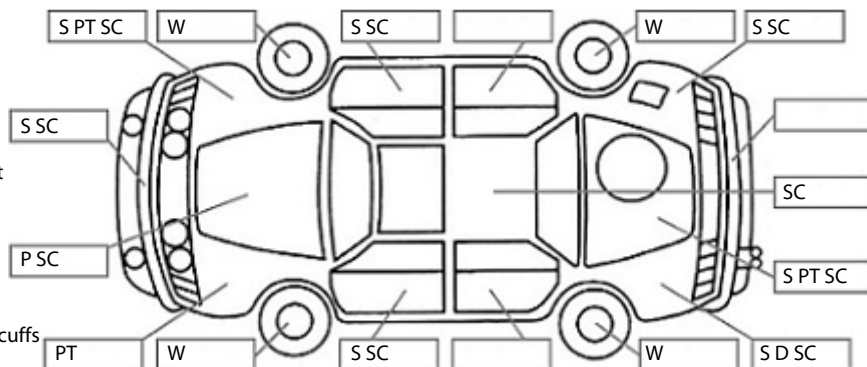

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Clearcoat coming off vehicle. LH numberplate lamp not going. Damage on LH sill and front edge of tray. Stonechips on windscreen. Flare on LHS of front bumper not secure. Bonnet painted mat black. Rear seats and seatbelts removed. Wear on RF seat and steering wheel. No jack or tools.

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufacturers recommended level, contains water only, no additive, suggest coolant change and flush. Pod air filter fitted. Edge wear all tyres. Engine, power steering rack, gearbox and rear diff head all have oil leaks. Exhaust modified and loud.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Engine light on intermittently.
Engine is noisy. Idle is high and uneven.
Crack in lens over speedometer. AC not cold.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 280,250

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition		✓	
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	1.6	mm	
Right front	1.3	mm	
Left rear	1	mm	
Right rear	0.4	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 14 Nov 2019

I have read and understood this condition guide.

Name:

Signature: