


Make: Ford	Model: Falcon	Body Style: Wagon
Year: 2004	Registration: CFB811	Reg Expiry: 23 Jan 2020
WoF Expiry: 17 Jan 2020	Odometer: 250,858 Kms	Good No: 19874856
VIN: 6FPAAAJGWA4E4736!	Next Service:	Service History: No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- * = decals
- SC = stone chips
- W = significant scuffs

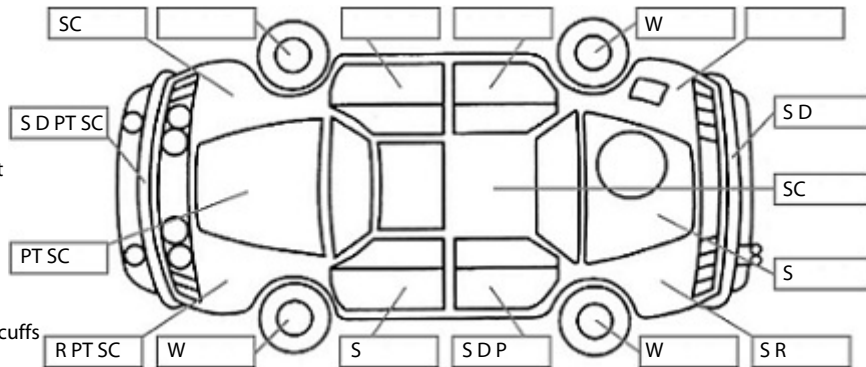

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Clearcoat coming off vehicle. Surface rust on LF guard. Damage on LH monsoon. Damage on tint LR door. Rust around LR cargo glass at top. Rear bumper not fitting correctly RHS. Rust marks around mounting brackets inside tailgate on body. Stonechips on windscreen. Cargo blind missing.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Coolant additive concentration below manufacturers recommended level, suggest coolant change. Power steering pump and high pressure hose have oil seepage. Rust on top of RF suspension tower. Engine has oil leaks. Steering rack has oil seepage. Surface rust under floor.

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Rust on LR guard above sill. Wear on RF seat and seatbelt. Wear on console lid and LR door card. Horn not working. Engine idle is rough.

Drives ok.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
 Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints			✓
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	5	mm	
Right front	2	mm	
Left rear	2	mm	
Right rear	1.3	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Roger King

Date: 21 Nov 2019

I have read and understood this condition guide. Name: Signature: