

# **Basic Vehicle Condition Guide**

Report ID: 19,889,516


Version: 1

Created: 03 Dec 2019

Make: Model: Peugeot 406 **Body Style:** Sedan Year: 2000 Registration: DCW923 **Reg Expiry:** 31 Jan 2020 WoF Expiry: **Odometer:** 25 Feb 2020 220,422 Kms **Good No:** 19889516 VIN: VF38BRFRR81120825 Next Service: 223500 **Service History:** 

#### Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

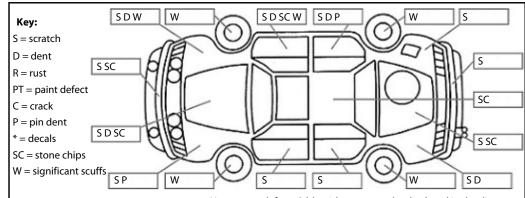

# **Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Trim missing RF guard. Stonechips on windscreen. LH indicator repeater lamp has lens missing. Body rubber under RF door is damaged.

Wear on RF seat and seatbelt. RF door card not fitting correctly and inner door handle surround missing. Steering wheel is worn.

Conditions During Body Inspection: Dry

## **Under Carriage & Under Bonnet Inspection Comments**

Cambelt has been changed but cannot read km's, so should be checked. Coolant additive concentration below manufacturers recommended level, suggest coolant change. Engine has oil seepage.

<u>Interior Comments</u>				
Seats	Average			
Carpets	Average			
Panels	Average			
Dashboard	Average			

### **General Comments**

Drives ok.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes

Kms: 1

	Pass	Fail	N/A	
Engine				
Oil level	~			
Smoke & fumes	v v			
Performance	~			
Noise	~			
Cooling System				
Coolant condition	~			
Performance	~			
Radiator / Hoses (visual)	~			
Transmission				
Operation	~			
Noise	~			
Clutch			~	
CV joints	~			
Wheel bearings	~			
Brakes				
Performance	<b>V</b>			
Hand Brake	~			
Tyres (lowest observed tread	depth	of tyre	 es)	
Left front	· ·		mm	
Right front		5	mm	
Left rear	1.8		mm	
Right rear	3		mm	
Spare	•	Yes		
Suspension		103		
Suspension performance	<b>V</b>			
Steering performance	<i>V</i>			
Shock absorbers	·			
Air Conditioning / Heater				
Operation	~			
Electrical / Accessories				
Head lights	./			
Tail lights	•			
Indicators	<i>y</i>			
Dashboard warning lights	V V V V V V V			
Wipers (front & rear)	•			
Window winder FL	•			
Window winder FR	•			
Window winder RL	•			
Window winder RR				
Rear view mirrors	<b>V</b>			
	<b>V</b>			
Radio (basic test only)	<b>V</b>			
CD (basic test only)	1			
Number of keys	1			
Central locking	/			
Remote locking	-			
Sat. Nav. (basic test only)			<b>'</b>	

Reversing camera

1

Signature: .....

Inspected by: Roger King Date: 03 Dec 2019

Name: .....