


Make:	Nissan	Model:	Maxima	Body Style:	Sedan
Year:	2005	Registration:	CZB250	Reg Expiry:	03 Oct 2020
WoF Expiry:	08 Jun 2020	Odometer:	237,016 Kms	Good No:	19968667
VIN:	JN1BBUJ31A0023508	Next Service:	238,000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

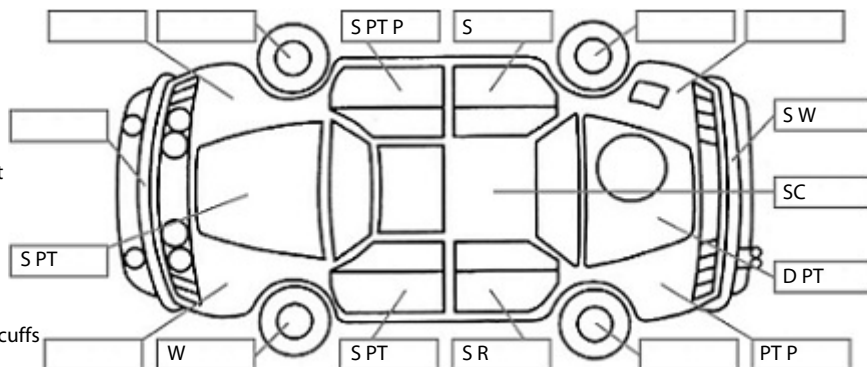

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Front bumper misaligned. Rust on rear glass frame. FL tyre sidewall cut
Stone chips on front windscreen. Driver's seat back trim insecure.
Number plate light not working. Far fog lamp cracked. RL door quarter trim missing. Wing mirrors not checked, switch gone inside

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

Bonnet gas strut weak. Radiator support rusty, bushes broken
RH inner CV boot leak. Steering rack leak. Engine oil leak
Transmission oil leak. Front wheel drive
Underbody surface rust

Interior Comments

Seats	Average
Carpets	Average
Panels	Average
Dashboard	Average

General Comments

Engine noisy and weak
AC not working
Transmission jerk while taking off
Teat drive not done due to the engine noise

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Timing Chain
Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes			✓
Performance		✓	
Noise		✓	
Cooling System			
Coolant condition	✓		
Performance			✓
Radiator / Hoses (visual)	✓		
Transmission			
Operation		✓	
Noise			✓
Clutch			✓
CV joints		✓	
Wheel bearings	✓		
Brakes			
Performance			✓
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	4	mm	
Right front	4	mm	
Left rear	5	mm	
Right rear	5	mm	
Spare	Yes		
Suspension			
Suspension performance			✓
Steering performance			✓
Shock absorbers	✓		
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors		✓	
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Mathew Varghese

Date: 24 Dec 2019

I have read and understood this condition guide.

Name:

Signature: