


<b>Make:</b> Nissan	<b>Model:</b> Terrano	<b>Body Style:</b> Wagon
<b>Year:</b> 1998	<b>Registration:</b> CFL425	<b>Reg Expiry:</b> 18 Jan 2020
<b>WoF Expiry:</b> 29 Jul 2020	<b>Odometer:</b> 284,682 Kms	<b>Good No:</b> 20012215
<b>VIN:</b> 7A8DH2B0704570236	<b>Next Service:</b> 288,500kms	<b>Service History:</b> No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

- S = scratch
- D = dent
- R = rust
- PT = paint defect
- C = crack
- P = pin dent
- \* = decals
- SC = stone chips
- W = significant scuffs

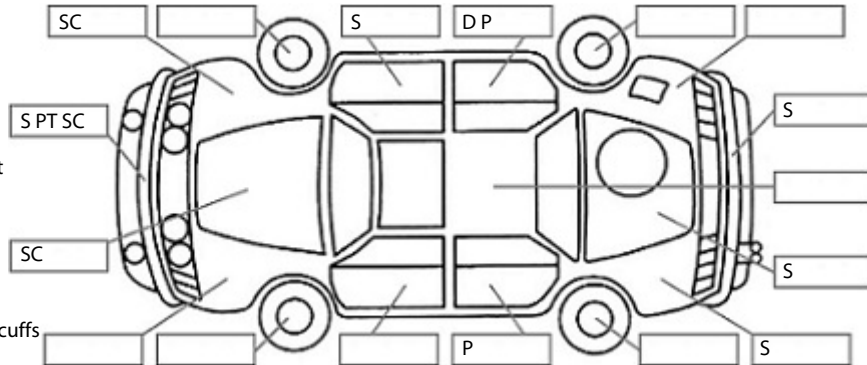

**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Petrol flap is bent & is not fitting correctly. Drivers door monsoon shield has parts of it missing. Stone crack/hole in right front head light, has been sealed up.

Conditions During Body Inspection: Dry

**Under Carriage & Under Bonnet Inspection Comments**

Minor oil leak from right side of engine & from between engine & gearbox.

**Interior Comments**

Seats	Good
Carpets	Average
Panels	Good
Dashboard	Good

**General Comments**

Carpet in right front foot well area has a hole in it, all carpets are dirty & stains in them. Stitching split on base of drivers seat.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt  
 Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front	1.8	mm	
Right front	2.0	mm	
Left rear	8.8	mm	
Right rear	9.0	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 10 Feb 2020

I have read and understood this condition guide. Name: ..... Signature: .....