

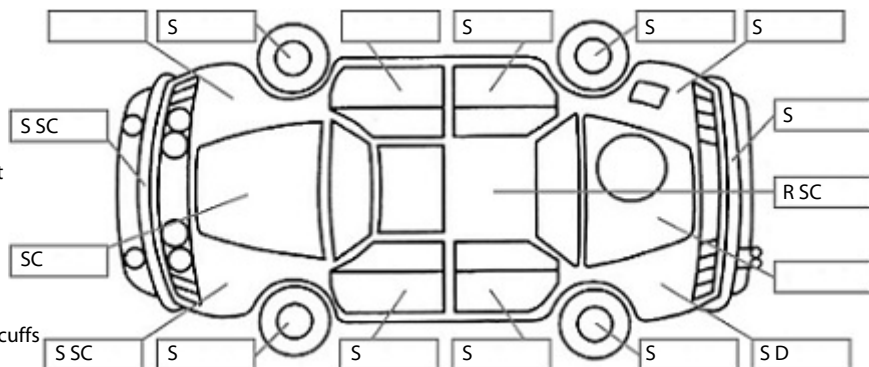
<b>Make:</b>	Hyundai	<b>Model:</b>	Santa Fe	<b>Body Style:</b>	Wagon
<b>Year:</b>	2010	<b>Registration:</b>	FMG42	<b>Reg Expiry:</b>	15 Nov 2020
<b>WoF Expiry:</b>	24 Feb 2021	<b>Odometer:</b>	267,721 Kms	<b>Good No:</b>	20019640
<b>VIN:</b>	KMHSH81XSAU64343	<b>Next Service:</b>	277,800kms	<b>Service History:</b>	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key:**

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs


**Body Inspection Comments**

Note: some defects & blemishes may not be displayed in the diagram

Screw holes in dashboard. One of key remotes is not working to lock or unlock vehicle. Stone chips in windscreen. Indicator lens in right side wing mirror is crack & has a bit broken off it.

Conditions During Body Inspection: Wet

**Under Carriage & Under Bonnet Inspection Comments**

Minor oil leak from rear of engine.

**Interior Comments**

Seats	Average
Carpets	Good
Panels	Average
Dashboard	Average

**General Comments**

Both left side door electric windows are not going up with master switch on drivers door, only works switches on both doors. Right rear door electric window only working from master switch. Left front interior roof handle has come off. Reversing camera screen is not showing up very clear.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Timing Chain

Evidence of Cam Belt Replacement: Not Applicable Kms:

	Pass	Fail	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
<b>Cooling System</b>			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand Brake	✓		
<b>Tyres</b> (lowest observed tread depth of tyres)			
Left front	7.0	mm	
Right front	8.0	mm	
Left rear	8.6	mm	
Right rear	8.6	mm	
Spare	Yes		
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators		✓	
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR		✓	
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. Nav. (basic test only)			✓
Reversing camera	✓		

Inspected by: Jason Young

Date: 13 Feb 2020

I have read and understood this condition guide.

Name: .....

Signature: .....