


|                    |                   |                      |             |                         |             |
|--------------------|-------------------|----------------------|-------------|-------------------------|-------------|
| <b>Make:</b>       | Honda             | <b>Model:</b>        | Odyssey     | <b>Body Style:</b>      | Wagon       |
| <b>Year:</b>       | 2001              | <b>Registration:</b> | EFK957      | <b>Reg Expiry:</b>      | 31 Jan 2020 |
| <b>WoF Expiry:</b> | 18 Oct 2020       | <b>Odometer:</b>     | 280,814 Kms | <b>Good No:</b>         | 20247050    |
| <b>VIN:</b>        | 7A88G610707059365 | <b>Next Service:</b> |             | <b>Service History:</b> | No          |

## Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

## Key:

S = scratch  
D = dent  
R = rust  
PT = paint defect  
C = crack  
P = pin dent  
\* = decals  
SC = stone chips  
W = significant scuffs

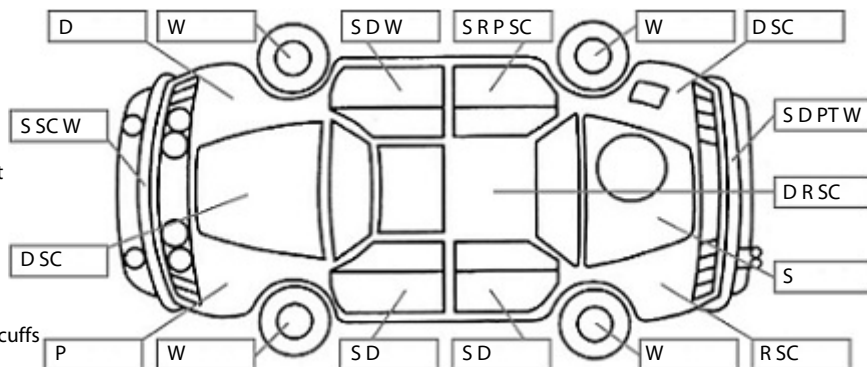

## Body Inspection Comments

Badge missing  
Wiper scratches on windscreen  
Rear bumper alignment both sides  
Rear left tyre outer edge wear

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Dry

## Under Carriage & Under Bonnet Inspection Comments

Upper glove box hinges loose  
Wing mirror adjustment button broken  
Key doesn't work in door  
Left visor doesn't stay up  
Brakes worn shudder on steering wheel

## Interior Comments

|           |   |
|-----------|---|
| Seats     | Stains  |
| Carpets   | Holes, stains, wear                           |
| Panels    | Front left door console cracked, handles worn |
| Dashboard | Scratches, worn, centre console paint/stains  |

## General Comments

Engine oil leak  
Power steering oil leak  
Squeaking and knock in front suspension  
Steering wheel cover worn  
Drivers seat loose

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 212,195

|   | Pass | Fail | N/A |
|---|------|------|-----|
| <b>Engine</b>                                       |      |      |     |
| Oil level   | ✓    |      |     |
| Smoke & fumes                                       | ✓    |      |     |
| Performance   | ✓    |      |     |
| Noise   | ✓    |      |     |
| <b>Cooling System</b>                               |      |      |     |
| Coolant condition                                   | ✓    |      |     |
| Performance   | ✓    |      |     |
| Radiator / Hoses (visual)                           | ✓    |      |     |
| <b>Transmission</b>                                 |      |      |     |
| Operation   | ✓    |      |     |
| Noise   | ✓    |      |     |
| Clutch  |      |      | ✓   |
| CV joints   | ✓    |      |     |
| Wheel bearings                                      | ✓    |      |     |
| <b>Brakes</b>                                       |      |      |     |
| Performance   |      | ✓    |     |
| Hand Brake  | ✓    |      |     |
| <b>Tyres</b> (lowest observed tread depth of tyres) |      |      |     |
| Left front  | 5    | mm   |     |
| Right front   | 6    | mm   |     |
| Left rear   | 2    | mm   |     |
| Right rear  | 2    | mm   |     |
| Spare   |      | Yes  |     |
| <b>Suspension</b>                                   |      |      |     |
| Suspension performance                              |      | ✓    |     |
| Steering performance                                | ✓    |      |     |
| Shock absorbers                                     | ✓    |      |     |
| <b>Air Conditioning / Heater</b>                    |      |      |     |
| Operation   | ✓    |      |     |
| <b>Electrical / Accessories</b>                     |      |      |     |
| Head lights   | ✓    |      |     |
| Tail lights   | ✓    |      |     |
| Indicators  | ✓    |      |     |
| Dashboard warning lights                            | ✓    |      |     |
| Wipers (front & rear)                               | ✓    |      |     |
| Window winder FL                                    | ✓    |      |     |
| Window winder FR                                    | ✓    |      |     |
| Window winder RL                                    | ✓    |      |     |
| Window winder RR                                    | ✓    |      |     |
| Rear view mirrors                                   |      | ✓    |     |
| Radio (basic test only)                             | ✓    |      |     |
| CD (basic test only)                                | ✓    |      |     |
| Number of keys                                      | 1    |      |     |
| Central locking                                     |      | ✓    |     |
| Remote locking                                      |      |      | ✓   |
| Sat. Nav. (basic test only)                         |      |      | ✓   |
| Reversing camera                                    |      |      | ✓   |

Inspected by: John Lindsay

Date: 10 Mar 2020

I have read and understood this condition guide.

Name: .....

Signature: .....