


Make:	Mazda	Model:	Demio	Body Style:	Hatchback
Year:	2000	Registration:	DJG692	Reg Expiry:	16 Jul 2020
WoF Expiry:	14 Feb 2021	Odometer:	263,841 Kms	Good No:	20337336
VIN:	7A8C12H0706301013	Next Service:	?	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

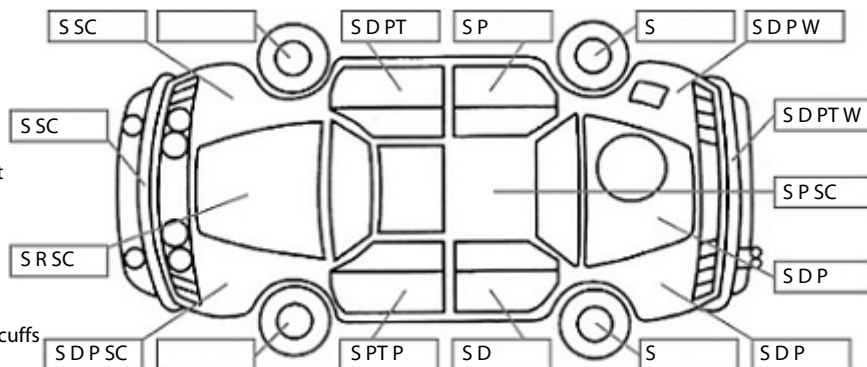

Body Inspection Comments

- Stone chips in windscreen.
- Right rear tail light lens is cracked & broken, has been glued back together.
- Paint worn off left & right side wing mirrors.
- Door window seals at bottom of window of both right side & left side doors have bits of rubber missing out of them.

Note: some defects & blemishes may not be displayed in the diagram

Conditions During Body Inspection: Wet

Under Carriage & Under Bonnet Inspection Comments

- Oil leak between engine & gearbox, also leaking oil around engine sump pan.
- Right & left side outer cv boots are split.
- Have to hold ignition in start position for a few seconds to get starter motor to turn over.
- Engine oil level is below the low mark on engine dip stick.

Interior Comments

Seats	Good
Carpets	Average
Panels	Good
Dashboard	Good

General Comments

- Boot carpets dirty & stained.
- Vehicle jack is missing.
- Left side wing mirror will not fold in with switch.
- Rear window washer is not working.
- Left front hub cap missing.

Road Conditions During Test Drive: Wet

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: Yes Kms: 242,250

	Pass	Fail	N/A
Engine			
Oil level		✓	
Smoke & fumes	✓		
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	3.8	mm	
Right front	4.2	mm	
Left rear	4.0	mm	
Right rear	4.4	mm	
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Jason Young

Date: 06 Jul 2020

I have read and understood this condition guide.

Name:

Signature: