


Make:	Fiat	Model:	Ducato	Body Style:	Van
Year:	2007	Registration:	DUA542	Reg Expiry:	18 Feb 2024
WoF Expiry:	10 Jul 2024	Odometer:	414,343 Kms	Good No:	24447191
VIN:	ZFA25000001069467	Next Service:	0	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key:

S = scratch
D = dent
R = rust
PT = paint defect
C = crack
P = pin dent
* = decals
SC = stone chips
W = significant scuffs

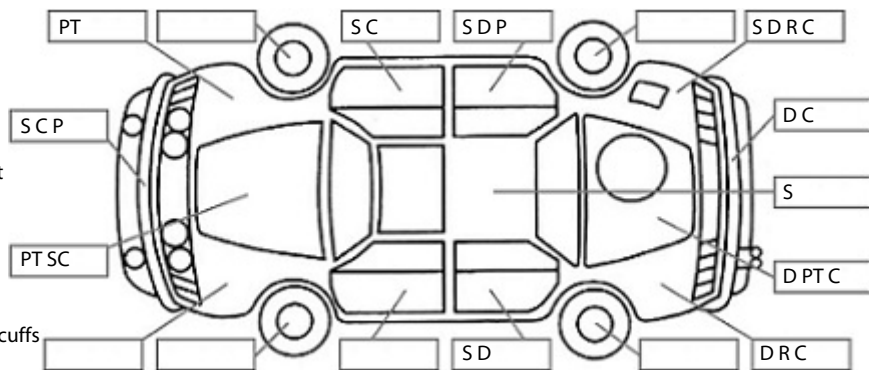

Body Inspection Comments

Note: some defects & blemishes may not be displayed in the diagram

Spare tyre missing. Right side mirror damaged.
RL sliding door and left back door damaged and won't open.
Missing body panels. Cargo area damaged.
Dash lights some not working.
W/S stone chip out of CVA.

Conditions During Body Inspection: Dry

Under Carriage & Under Bonnet Inspection Comments

FWD
Hood prop stick missing.
Vapour canister has oil stains. (Right of engine bay)
Transmission oil drain bolt leak.
CV axles outer boots grease leaks.
RL shock leaking.

Interior Comments

Seats	Poor
Carpets	Poor
Panels	Poor
Dashboard	Poor

General Comments

Check engine light on. Instrument cluster missing speedometer.
Interior panels missing/loose. One panel gets caught on shoes above clutch.
Keeps bouncing after speed bumps.
Exhaust fumes inside cabin.
No air out of vents. A/C not cold.
Steering wheel loose. Reverse lights not working.

Road Conditions During Test Drive: Dry

Engine Timing Mechanism: Cambelt

Evidence of Cam Belt Replacement: No Kms:

	Pass	Fail	N/A
Engine			
Oil level	✓		
Smoke & fumes		✓	
Performance	✓		
Noise	✓		
Cooling System			
Coolant condition	✓		
Performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch		✓	
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand Brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front	8	mm	
Right front	8	mm	
Left rear	8	mm	
Right rear	9	mm	
Spare	No		
Suspension			
Suspension performance		✓	
Steering performance	✓		
Shock absorbers		✓	
Air Conditioning / Heater			
Operation		✓	
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights		✓	
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. Nav. (basic test only)			✓
Reversing camera			✓

Inspected by: Eleoit Kumar

Date: 12 Oct 2023

I have read and understood this condition guide.

Name:

Signature: