

Report ID:	24,876,111	Version:	4
Created:	18 Mar 2026		


Make:	Hyundai	Model:	Iload
Body Style:	Van	Year:	2013
Rego No.:	HBA24	Rego Expiry:	25 May 2026
WoF Expiry:	30 Oct 2026	Odometer:	302,435 Kms
Good No.:	24876111	VIN:	KMFWBX7KLDU582847
Next Service:	304,425kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

### Key

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

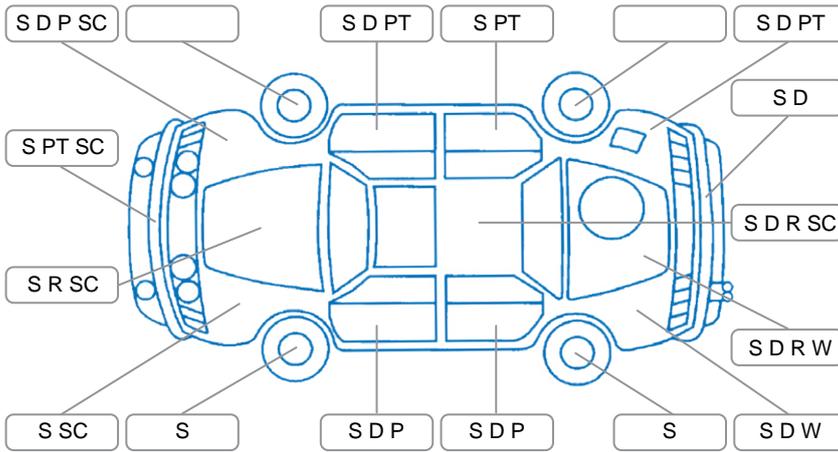

Note: some defects and blemishes may not be displayed in the diagram

### Body Inspection Comments

Four small stone cracks in windscreen. GPS dome fitted to roof. Left front corner of roof rack needs refitted to roof. Lens missing off left front guard repeater light. Rust along top edge of windscreen.

Conditions During Body Inspection	Dry
-----------------------------------	-----

### Under Carriage and Under Bonnet Inspection Comments

Oil leak from engine.

### Interior Comments

Seats:	Poor
Carpets:	Average
Panels:	Average
Dashboard:	Average

### General Comments

Large hole & foam missing out of base pad on driver's seat. Interior panel on rear tailgate has a hole in it. Interior door handle missing off tailgate. Rear wiper arm is broken. Hole in carpet in right front foot well area. Clutch pedal grip pad missing. Cd player is not working.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No    Kms
Inspected by:	Jason Young
Published by:	Glen Charlton
Inspection Date:	11 Mar 2026

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints			✓
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			6.0 mm
Right front			6.0 mm
Left rear			3.0 mm
Right rear			3.5 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights	✓		
Indicators			✓
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	2		
Central locking	✓		
Remote locking		✓	
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_