

Report ID:	24,876,202	Version:	2
Created:	24 Mar 2026		


Make:	Hyundai	Model:	Staria Load
Body Style:	Van	Year:	2022
Rego No.:	PPA199	Rego Expiry:	21 May 2026
WoF Expiry:	02 Dec 2026	Odometer:	177,416 Kms
Good No.:	24876202	VIN:	KMFYFX71MNU078499
Next Service:	190,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

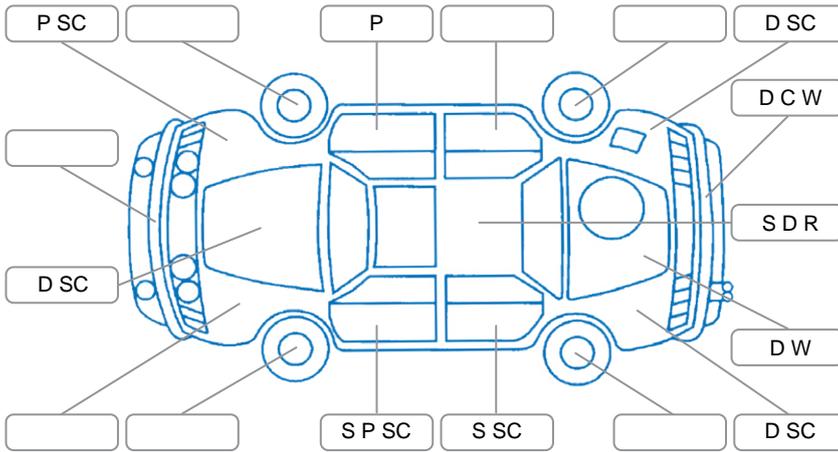

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Bolt anchors and holes in roof gutters for roof rack base. (Not sealed properly). After market rear step is bent. Numbers of minor dents on bonnet. Minor dents on both side A pillars. Rear badge and decal are missing. Scuff and dents in cargo area.

Conditions During Body Inspection: Wet Dry

Under Carriage and Under Bonnet Inspection Comments

Both side rear guard liners are broken.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Good
Dashboard:	Fuse box cover is missing.

General Comments

Parking sensors are malfunction. Tire pressure warning is ON. Rear scuff plate is missing. Both side interior step covers are damaged. 1 of floor anchor is not fitted. (Other bolt is stuck in the hole). Right front CV boot is torn.

Road Conditions During Test Drive	Dry	
Engine Timing Mechanism	Timing Chain	
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No	Kms
Inspected by:	Yuki Itohara	
Published by:	Glen Charlton	
Inspection Date:	18 Mar 2026	

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints		✓	
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			7.5 mm
Right front			7.5 mm
Left rear			5.5 mm
Right rear			7.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____