

Report ID:	24,876,755	Version:	2
Created:	23 Apr 2026		


Make:	Toyota	Model:	Hiace
Body Style:	Van	Year:	2006
Rego No.:	KYG339	Rego Expiry:	06 Aug 2026
WoF Expiry:	25 Feb 2027	Odometer:	151,626 Kms
Good No.:	24876755	VIN:	7AT0H60FX13035863
Next Service:	133,836kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

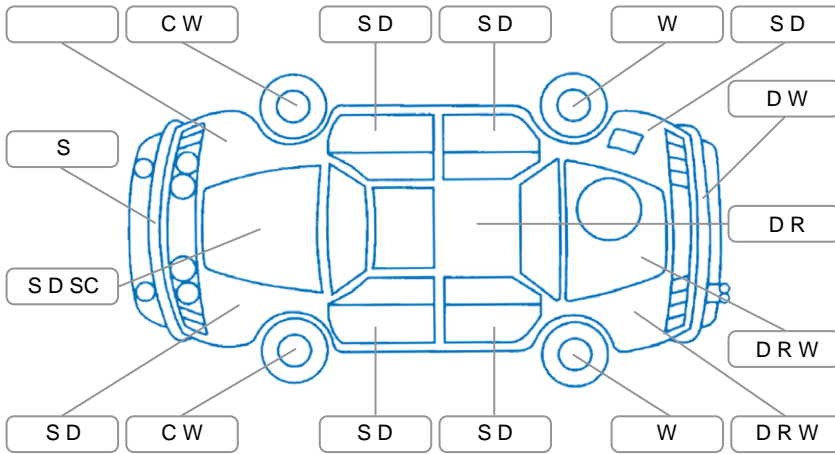

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Tow point cover in front bumper is missing. Left corner mirror is missing. Left sliding door rear side lock is faulty. (Can not close door properly). Rear emblem is missing. Rear bumper is not fitted correctly. Left tail light is cracked. Numbers of dents on roof. Inside wear of spare tyre.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Leaking from engine and transmission.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Poor
Dashboard:	Average

General Comments

Flat battery. Coolant reserve tank is empty and dirty. May need investigation and service including radiator. Left sliding door interior card board is missing. Left side of centre air vent is broken. Bench seat cup holder is broken,missing. Roof lining is damaged.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Yuki Itohara		
Published by:	Yuki Itohara		
Inspection Date:	23 Apr 2026		

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition		✓	
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			9 mm
Right front			6 mm
Left rear			5 mm
Right rear			5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	1		
Central locking	✓		
Remote locking			✓
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME _____

SIGNATURE _____