

Report ID:	24,876,764	Version:	2
Created:	21 Apr 2026		


Make:	Toyota	Model:	Hiace
Body Style:	Van	Year:	2014
Rego No.:	MDP792	Rego Expiry:	23 Nov 2026
WoF Expiry:	14 Aug 2026	Odometer:	169,649 Kms
Good No.:	24876764	VIN:	7AT0H60FX19204520
Next Service:	165,200kms	Service History:	No

**Note: This report is not a warranty**

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

**Key**

S = Scratch    R = Rust    C = Crack    \* = Decals    W = Significant scuffs  
 D = Dent    PT = Paint defect    P = Pin dent    SC = Stone Chips

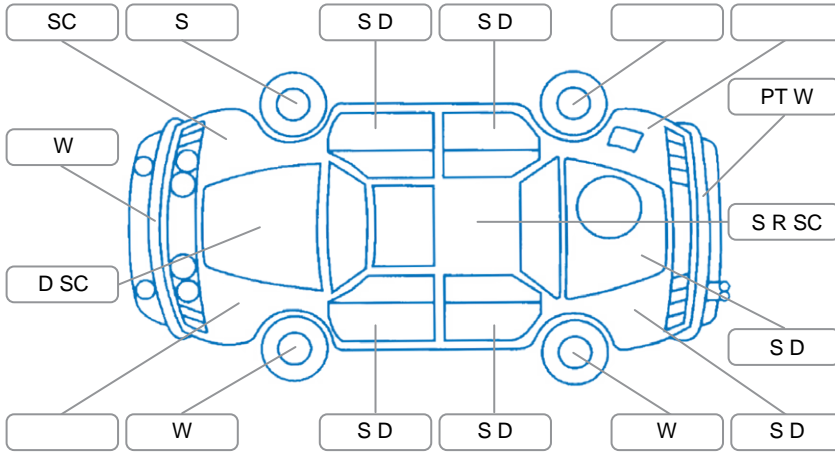

Note: some defects and blemishes may not be displayed in the diagram

**Body Inspection Comments**

Front tow pint cap is missing. Major stone crack in bottom centre black area of windshield. Out side edge wear of left front tyre. Left sill lip has minor bent. Dents and scuff around cargo area. Right tail light is cracked.

Conditions During Body Inspection: Dry

**Under Carriage and Under Bonnet Inspection Comments**

**Interior Comments**

Seats:	Right front base pad is damaged.
Carpets:	Average
Panels:	Average
Dashboard:	Average

**General Comments**

Roof lining moulding is missing. Tail gate lock cover is broken. Key blade is not matching with outside key cylinders. Left slide door lock actuator is faulty. Driver's seat belt is scuffed.

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes	<input type="checkbox"/> No	Kms
Inspected by:	Yuki Itohara		
Published by:	Glen Charlton		
Inspection Date:	21 Apr 2026		

	OK	Requires Attention	N/A
<b>Engine</b>			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
<b>Transmission</b>			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
<b>Brakes</b>			
Performance	✓		
Hand brake	✓		
<b>Tyres (lowest observed tread depth of tyres)</b>			
Left front			1.2 mm
Right front			2.5 mm
Left rear			5.0 mm
Right rear			5.0 mm
Spare		Yes	
<b>Suspension</b>			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
<b>Air Conditioning / Heater</b>			
Operation	✓		
<b>Electrical / Accessories</b>			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)		✓	
Number of keys	1		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera			✓

I have read and understood this condition guide:

NAME \_\_\_\_\_

SIGNATURE \_\_\_\_\_