


Report ID:	24,876,900	Version:	2
Created:	28 Apr 2026		

Make:	Holden	Model:	Equinox
Body Style:	SUV	Year:	2020
Rego No.:	NAS916	Rego Expiry:	03 Sep 2026
WoF Expiry:	09 Sep 2026	Odometer:	155,054 Kms
Good No.:	24876900	VIN:	3G0AX7EX2LS659657
Next Service:	163,000km's	Service History:	No

Note: This report is not a warranty
 This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key
 S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

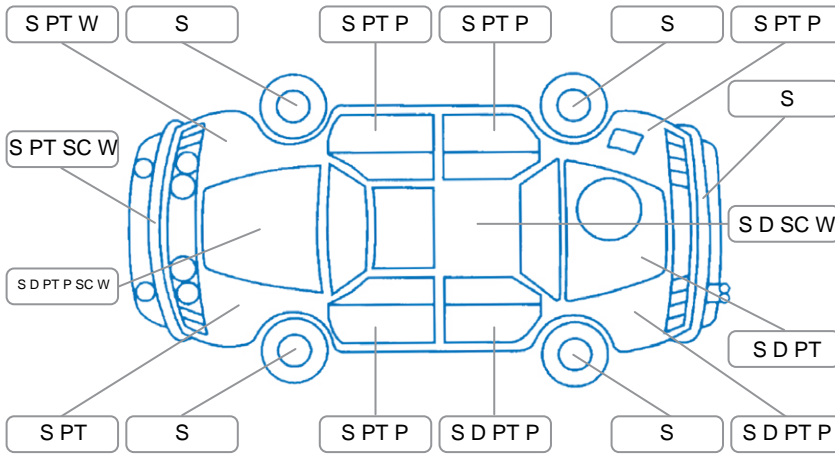

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Holes in all corners of both front & rear bumpers. Rubber grommet /dome & two R/T aerial bases fitted to roof panel.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Oil leak from engine.

Interior Comments

Seats:	Good
Carpets:	Good
Panels:	Average
Dashboard:	Good

General Comments

Screw holes in dashboard & left side of centre console. Plastic panel missing off top centre part of dashboard. Bolt holes in left front foot well area. Interior panel on tailgate has two holes in it. Sunglasses holder in front interior roof panel is missing. Non-factory boot floor panel fitted.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Jason Young
Published by:	Glen Charlton
Inspection Date:	28 Apr 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.0 mm
Right front			6.0 mm
Left rear			6.0 mm
Right rear			6.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____