

Report ID:	24,877,564	Version:	2
Created:	29 May 2026		


Make:	Mazda	Model:	Bt-50
Body Style:	Utility	Year:	2018
Rego No.:	LQE879	Rego Expiry:	26 Sep 2026
WoF Expiry:	08 Jun 2027	Odometer:	187,448 Kms
Good No.:	24877564	VIN:	MMOUR0YG100840708
Next Service:	?	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

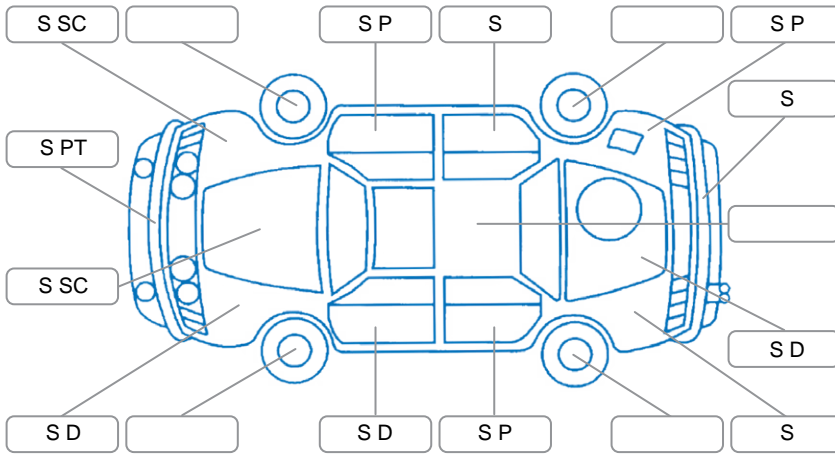

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Holes on inside lip of both front guard, where aerial brackets have been fitted. Dent in bottom rear edge of left front guard. Small stone crack in middle of windscreen. Paint flaking off front bumper. Left front spot light blank is missing out of front bumper. Rear bumper has been pushed into deck.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Average
Carpets:	Good
Panels:	Good
Dashboard:	Good

General Comments

Hole & fabric worn on base pad of driver's seat. Heater fan switch is broken. Holes in left side of centre console.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Jason Young
Published by:	Yuki Itohara
Inspection Date:	22 May 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			10.5 mm
Right front			7.0 mm
Left rear			10.0 mm
Right rear			10.5 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	3		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____