

Report ID:	24,877,691	Version:	6
Created:	02 Jun 2026		


Make:	Mitsubishi	Model:	Triton
Body Style:	Utility	Year:	2020
Rego No.:	NEL721	Rego Expiry:	02 Nov 2026
WoF Expiry:	03 Dec 2026	Odometer:	243,277 Kms
Good No.:	24877691	VIN:	MMAJLKL10MH000590
Next Service:	251,334kms	Service History:	Yes

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
 D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

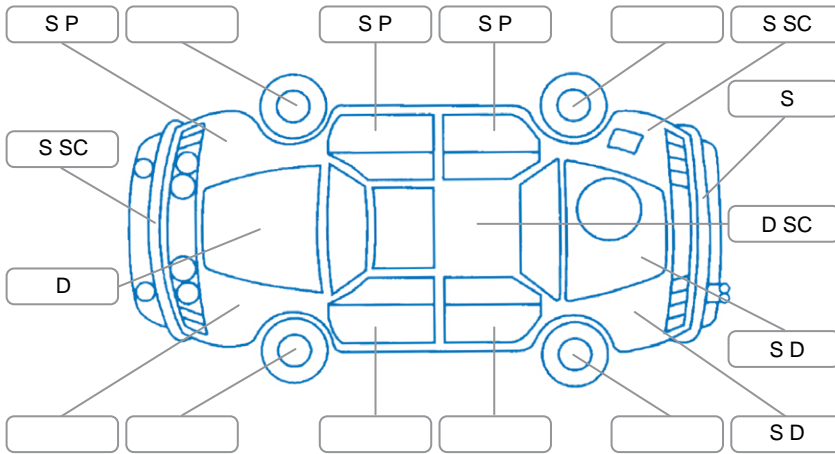

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Canopy back door lower moulding is missing. Both side end caps of running board are cracked. Screw holes inside of right front guard. Tail gate badge secured in hand book. Edge of left tail light is cracked. Dent in right cant rail. Minor chips in windshield. Shills paint worn.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Right front base pad is worn, torn.
Carpets:	Torn around right foot rest and centre console .
Panels:	Average
Dashboard:	Screw holes. Steering leather is torn.

General Comments

Left rear door interior seal is torn.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	<input type="checkbox"/> Yes <input type="checkbox"/> No Kms
Inspected by:	Yuki Itohara
Published by:	Glen Charlton
Inspection Date:	02 Jun 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			5.5 mm
Right front			6.5 mm
Left rear			3.5 mm
Right rear			3.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)			✓
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		

I have read and understood this condition guide:

NAME _____

SIGNATURE _____