

Report ID:	24,878,424	Version:	1
Created:	16 Jul 2026		


Make:	Mazda	Model:	Bt-50
Body Style:	Utility	Year:	2018
Rego No.:	LQS775	Rego Expiry:	02 Oct 2026
WoF Expiry:	20 Jul 2027	Odometer:	232,855 Kms
Good No.:	24878424	VIN:	MM0UR0YG100840709
Next Service:	240,000kms	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

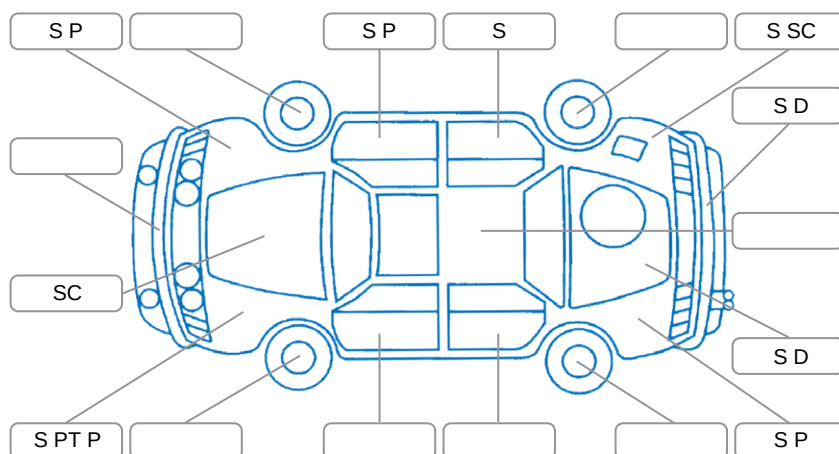

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Small stone crack in left side of windshield. Canopy spoiler is badly cracked. Right front door seal rubber is worn, torn. Rear bumper alignment required. Both sill paint is worn. Right headlight clear coat is fading.

Conditions During Body Inspection	Dry
-----------------------------------	-----

Under Carriage and Under Bonnet Inspection Comments

Interior Comments

Seats:	Right front base pad is worn, torn.
Carpets:	Average
Panels:	Paint of door handle is worn.
Dashboard:	Average

General Comments

Road Conditions During Test Drive	Dry		
Engine Timing Mechanism	Timing Chain		
Evidence of Cam Belt Replacement	☐ Yes	☐ No	Kms
Inspected by:	Yuki Itohara		
Published by:	Glen Charlton		
Inspection Date:	01 Jul 2026		

I have read and understood
this condition guide:

NAME _____

SIGNATURE _____

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch			✓
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			9.0 mm
Right front			9.0 mm
Left rear			8.0 mm
Right rear			8.5 mm
Spare	Yes		
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights	✓		
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL	✓		
Window winder RR	✓		
Rear view mirrors	✓		
Radio (basic test only)	✓		
CD (basic test only)	✓		
Number of keys	3		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera	✓		