

Report ID:	24,878,862	Version:	2
Created:	13 Aug 2026		


Make:	Hyundai	Model:	Iload
Body Style:	Van	Year:	2014
Rego No.:	HTB422	Rego Expiry:	30 May 2027
WoF Expiry:	01 Nov 2026	Odometer:	324,483 Kms
Good No.:	24878862	VIN:	KMFWBX7KLEU641756
Next Service:	339000	Service History:	No

Note: This report is not a warranty

This report is a guide only. Consideration is made for age and mileage. Parts have not been dismantled or diagnostic testing undertaken. The vehicle has been driven up to 50km/h from cold. The Vendor recommends a full mechanical inspection prior to purchase and this can be arranged for an additional charge.

Key

S = Scratch R = Rust C = Crack * = Decals W = Significant scuffs
D = Dent PT = Paint defect P = Pin dent SC = Stone Chips

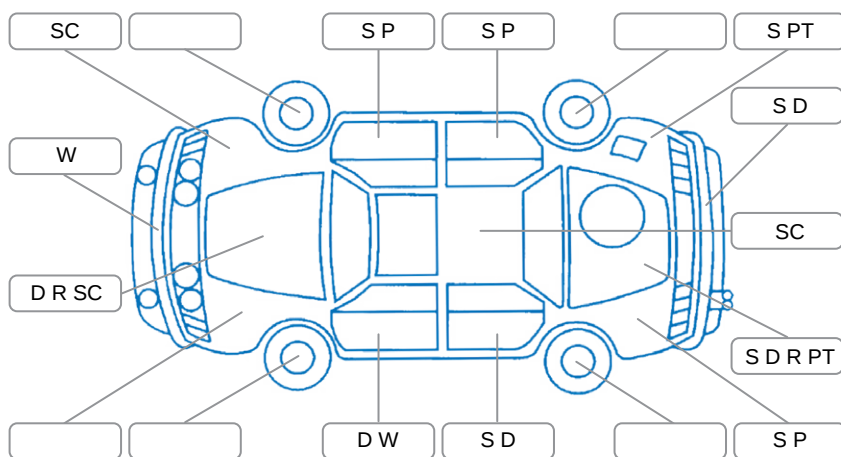

Note: some defects and blemishes may not be displayed in the diagram

Body Inspection Comments

Windshield side mouldings are missing. Tailgate struts are not operating. Rear wiper arm is broken. Tailgate step plate trim is broken. Inner frame around tailgate has surface rust. Left tail light is cracked. Right sill paint is worn.

Conditions During Body Inspection Dry

Under Carriage and Under Bonnet Inspection Comments

Leaking from around engine and transmission.

Interior Comments

Seats:	Average
Carpets:	Average
Panels:	Average
Dashboard:	Average

General Comments

Right reversing light is not operating. Picture of Reversing camera is not very clear. Pin number is missing to activate audio head unit.

Road Conditions During Test Drive	Dry
Engine Timing Mechanism	Timing Chain
Evidence of Cam Belt Replacement	☐ Yes ☐ No Kms
Inspected by:	Yuki Itohara
Published by:	Steve Ingram
Inspection Date:	24 Jul 2026

	OK	Requires Attention	N/A
Engine			
Oil level	✓		
Smoke & fumes	✓		
Engine performance	✓		
Noise	✓		
Coolant condition	✓		
Cooling performance	✓		
Radiator / Hoses (visual)	✓		
Transmission			
Operation	✓		
Noise	✓		
Clutch	✓		
CV joints	✓		
Wheel bearings	✓		
Brakes			
Performance	✓		
Hand brake	✓		
Tyres (lowest observed tread depth of tyres)			
Left front			3.0 mm
Right front			5.0 mm
Left rear			4.5 mm
Right rear			9.0 mm
Spare		Yes	
Suspension			
Suspension performance	✓		
Steering performance	✓		
Shock absorbers	✓		
Air Conditioning / Heater			
Operation	✓		
Electrical / Accessories			
Head lights	✓		
Tail lights		✓	
Indicators	✓		
Dashboard warning lights	✓		
Wipers (front & rear)	✓		
Window winder FL	✓		
Window winder FR	✓		
Window winder RL			✓
Window winder RR			✓
Rear view mirrors	✓		
Radio (basic test only)		✓	
CD (basic test only)		✓	
Number of keys	2		
Central locking	✓		
Remote locking	✓		
Sat. nav. (basic test only)			✓
Reversing camera		✓	

I have read and understood this condition guide:

NAME _____

SIGNATURE _____